

Document Number:
402548549

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 81490 Contact Name: ANDY PETERSON
 Name of Operator: ST CROIX OPERATING INC Phone: (970) 203-4263
 Address: P O BOX 13799 Fax: _____
 City: DENVER State: CO Zip: 80201 Email: andy@petersonenergyoperating.com

For "Intent" 24 hour notice required, Name: Sherman, Susan Tel: (719) 775-1111
COGCC contact: Email: susan.sherman@state.co.us

Type of Well Abandonment Report: Notice of Intent to Abandon Subsequent Report of Abandonment

API Number 05-121-10849-00
 Well Name: YOUNG Well Number: 12-11350
 Location: QtrQtr: SWNW Section: 11 Township: 3S Range: 50W Meridian: 6
 County: WASHINGTON Federal, Indian or State Lease Number: _____
 Field Name: SOMBRERO Field Number: 77632

Only Complete the Following Background Information for Intent to Abandon

Latitude: 39.810000 Longitude: -102.951222
 GPS Data: GPS Quality Value: 2.8 Type of GPS Quality Value: PDOP Date of Measurement: 11/06/2010

Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____

Casing to be pulled: Yes No Estimated Depth: _____
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA	2900	2930			
J SAND	4081	4085	06/16/2005	B PLUG CEMENT TOP	4046
Total: 2 zone(s)					

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	322	325	322	0	VISU
1ST	7+7/8	4+1/2	J55	10.5	0	4079	350	4079	2350	CBL

Subsurface hazards include, but are not limited to, the following: overpressured zones, underpressured zones, major geologic faults, salt sections, H2S at concentrations greater than or equal to 100 ppm.

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth _____ with _____ sacks cmt on top. CIPB #2: Depth _____ with _____ sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIPB #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 15 sks cmt from 2850 ft. to 2855 ft. Plug Type: OPEN HOLE Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 372 ft. with 112 sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 (Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:
 Set _____ sacks at surface
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
 Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____
 Surface Plug Setting Date: _____ Cut and Cap Date: _____
 *Wireline Contractor: _____ *Cementing Contractor: _____
 Type of Cement and Additives Used: _____
 Flowline/Pipeline has been abandoned per Rule 1105 Yes No

Technical Detail/Comments:
 a) MIRU w/Service rig.
 b) Pull tubing to 2,850 ft.
 c) Pump and displace 15 sacks of cement @ 2,850 ft.
 d) Pull tubing to 2,000 ft.
 e) Tag cement.
 f) Pull tubing.
 g) Perf Squeeze holes @ 372 ft.
 h) Pump 112 sks cement down 4-1/2" csg through squeeze holes up annulus to surface.
 i) Cut & cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.
 Signed: _____ Print Name: PAUL GOTTLOB
 Title: Regulatory & Engin. Tech. Date: _____ Email: paul.gottlob@iptenergyservices.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

COA Type **Description**

--	--

Attachment Check List

Att Doc Num **Name**

402549294	PROPOSED PLUGGING PROCEDURE
402549295	WELLBORE DIAGRAM
402549296	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

User Group **Comment**

Comment Date

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)