

**FORM
INSP**

Rev
X/20

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

02/03/2021

Submitted Date:

02/04/2021

Document Number:

688309648

FIELD INSPECTION FORM

Loc ID _____ Inspector Name: _____ On-Site Inspection
316944 _____ Sherman, Susan _____ 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

OGCC Operator Number: 10330
Name of Operator: INVESTMENT EQUIPMENT LLC
Address: 412 W PLATTE AVE
City: FT MORGAN State: CO Zip: 80701

Findings:

- 8 Number of Comments
- 1 Number of Corrective Actions
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
Crumley, Luke	(970) 324-0060	crumleypumping@gmail.com	
Highberger, Kathryn	(970) 867-9007	kathrynhighberger@gmail.com	Designated Agent
Chisholm, Jim	405-642-9437	investmentequipment@gmail.com	All Inspections
Young, Rob		rob.young@state.co.us	COGCC EPS

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
233377	WELL	PR	11/06/1963	OW	121-05413	DAVIS W T 1	PR

General Comment:

Reinspection, passed
Installed stormwater BMP on east end of pit to prevent off location sediment transport.

Inspected Facilities

Facility ID: 233377 Type: WELL API Number: 121-05413 Status: PR Insp. Status: PR

Producing Well

Comment: PR

Corrective Action:

Date:

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Compaction	Fail					

Comment: Erosion rill on east side of pit.

Corrective Action: Install or repair required BMPs per Rule 1002.f.(2)C.

Date: 02/22/2021

Pits: NO SURFACE INDICATION OF PIT

Type: Produced Water Lined: NO Pit ID: Lat: Long:

Reference Point: _____ Other: _____ Length: _____ Width: _____

Lining:

Liner Type: Liner Condition:

Comment:

Corrective Action

Date:

Fencing:

Fencing Type: None Fencing Condition:

Comment:

Corrective Action

Date:

Netting:

Netting Type: Netting Condition:

Comment:

Corrective Action

Date:

Anchor Trench Present: Oil Accumulation: 2+ feet Freeboard:

Comment: west pit, deminimus oil in boom, remove oil

Corrective Action

Date:

Type: Produced Water Lined: NO Pit ID: Lat: Long:

Reference Point: _____ Other: _____ Length: _____ Width: _____

Lining:

Liner Type: Liner Condition:

Comment:

Corrective Action

Date:

Fencing:

Fencing Type: None Fencing Condition:

Comment:

Corrective Action

Date:

Netting:

Netting Type: Netting Condition:

Comment:

Corrective Action

Date:

Anchor Trench Present:

Oil Accumulation:

2+ feet Freeboard:

Comment:

Recent work on pit berms on north and south sides and below east pit (see attached photos).
Check if stained soils in photos are oil stained soils and remove and properly dispose of if so.

Corrective Action

Date:

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
688309662	Investment Equipment Davis W T 1	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5345434