

Document Number:
402595835

Date Received:
02/09/2021

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322 Contact Name: Dustin Stevens
 Name of Operator: NOBLE ENERGY INC Phone: (720) 297-5523
 Address: 1001 NOBLE ENERGY WAY Fax: _____
 City: HOUSTON State: TX Zip: 77070 Email: dustin.stevens@nbleenergy.com

For "Intent" 24 hour notice required, Name: Santistevan, Brittani Tel: (720) 471-1110
 Email: brittani.santistevan@state.co.us
COGCC contact: _____

Type of Well Abandonment Report: Notice of Intent to Abandon Subsequent Report of Abandonment

API Number 05-123-33500-00
 Well Name: LINDBLAD PC MM Well Number: 25-15
 Location: QtrQtr: SWSE Section: 25 Township: 7N Range: 67W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.539620 Longitude: -104.838730
 GPS Data: GPS Quality Value: 2.5 Type of GPS Quality Value: PDOP Date of Measurement: 12/13/2011

Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____

Casing to be pulled: Yes No Estimated Depth: 1117
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7404	7416			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	917	347	917	0	VISU
1ST	7+7/8	4+1/2	M-80	11.6	0	7585	550	7585	2310	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7350 with 2 sacks cmt on top. CIBP #2: Depth 7157 with 2 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 255 sks cmt from 817 ft. to 0 ft. Plug Type: CASING Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 2321 ft. with 155 sacks. Leave at least 100 ft. in casing 2219 CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 115 sacks half in. half out surface casing from 1117 ft. to 817 ft. Plug Tagged:
Set _____ sacks at surface
Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____
Surface Plug Setting Date: _____ Cut and Cap Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 Yes No

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Stephanie Dionne
Title: Operations Tech Date: 2/9/2021 Email: stephanie.dionne@nblenergy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: JENKINS, STEVE Date: 2/11/2021

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: 8/10/2021

COA Type	Description
	<p>1) Provide 2 business days notice of plugging MIRU via electronic Form 42.</p> <p>2) Prior to placing the 1117 plug: verify that all fluid migration (liquid or gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>3) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 867' or shallower and provide 10 sx plug at the surface.</p> <p>4) Leave at least 100' of cement in the wellbore for each plug.</p> <p>5) Properly abandon flowlines per Rule 1105. File electronic Form 42 once abandonment of on-location flowlines is complete. Within 90 days of an operator completing abandonment requirements for an off-location flowline or crude oil transfer line the operator must submit a Flowline Report, Form 44.</p> <p>6) With the Form 6 SRA operator must provide written documentation which positively affirms each COA has been addressed.</p> <p>7) After placing the shallowest hydrocarbon isolating plug (2321'), operator must wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or fluid migration, contact COGCC engineering before continuing operations.</p>
	<p>Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.</p>
	<p>Prior to starting plugging operations a Bradenhead test shall be performed if there has not been a reported Bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the COGCC within three (3) months of collecting the samples.</p>
	<p>Submit Operator's Monthly Production Reports (Form 7) required for compliance with Rule 413 within 30 days: 12/2011</p>

Attachment List

Att Doc Num	Name
402595835	FORM 6 INTENT SUBMITTED
402595867	WELLBORE DIAGRAM
402595869	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Engineer	1) Deepest Water Well within 1 mile = 92'. 2) Fox Hills Bottom- N/A, per SB5.	02/11/2021
Engineer	In accordance with the Notice to Operators (NTO): Timing for COGCC Forms adopted on 05/01/2020, this Form 6 Notice of Intent to Abandon is valid for 12 months from the date of approval expiring on 2/11/2022. This NTO does not alter the deadlines for submission of, or compliance with any other Commission rule or Form.	02/11/2021
Permit	Verified as-drilled GPS. Verified perf zone. Form 7 reporting missing: 12/2011. COA placed. Permitting review complete.	02/11/2021

Total: 3 comment(s)