

FORM
6Rev
11/20

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

402598598

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER

State: CO

Zip: 80203

Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required,

Name:

Tel:

COGCC contact:

Email:

Type of Well Abandonment Report: ☐ Notice of Intent to Abandon ☒ Subsequent Report of Abandonment

API Number 05-123-23590-00

Well Name: PHINNEY

Well Number: 43-10

Location: QtrQtr: NESE

Section: 10

Township: 6N

Range: 64W

Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.499330

Longitude: -104.528560

GPS Data: GPS Quality Value: 3.3 Type of GPS Quality Value: Date of Measurement: 12/14/2006

Reason for Abandonment: ☐ Dry ☐ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes ☐ No

Estimated Depth:

Fish in Hole: ☐ Yes ☐ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes ☐ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6912	6920	01/12/2021	B PLUG CEMENT TOP	6862

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	578	410	578	0	VISU
1ST	7+7/8	4+1/2	J55	10.5	0	7097	185	7097	6359	CBL
S.C. 1.1						6539	280	6359	2816	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6862 with 2 sacks cmt on top. CIBP #2: Depth 6561 with 2 sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set <u>100</u> sks cmt from <u>2550</u> ft. to <u>2300</u> ft.	Plug Type: <u>STUB PLUG</u>	Plug Tagged: <input type="checkbox"/>
Set <u>100</u> sks cmt from <u>1650</u> ft. to <u>1450</u> ft.	Plug Type: <u>OPEN HOLE</u>	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 380 sacks half in. half out surface casing from 778 ft. to 0 ft. Plug Tagged: ☒

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: 2500 ft. of 4+1/2 inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: 9
 Surface Plug Setting Date: 01/13/2021 Cut and Cap Date: 01/22/2021

*Wireline Contractor: Rocky Mtn Wireline Services

*Cementing Contractor: DUCO Inc. Cementing Services

Type of Cement and Additives Used: Class G 15.8 PPG Cement

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Phinney 43-10 (05-123-23590)/Plugging Procedure
 Producing Formation: Codell: 6912'-6920'
 Upper Pierre Aquifer: 550'-1550'
 TD: 7115' PBTD: 7097' (2/9/2006)
 Surface Casing: 8 5/8" 24# @ 578' w/ 410 sxs cmt
 Production Casing: 4 1/2" 10.5# @ 7097' w/ 465 sxs cmt (TOC @ 2816' - CBL)

Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6862'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Codell perms @ 6912')
4. TIH with CIBP. Set BP at 6561'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Niobrara @ 6611')
5. TIH with casing cutter. Cut 4.5" casing at 2500'. Pull cut casing.
6. TIH with tubing to 2550'. RU cementing company. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Stub plug from 2550'-2300') TOC at 2300'.
7. Wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or fluid migration, contact engineering before continuing operations
8. TIH with tubing to 1650'. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Pierre coverage from 1650'-1450'). TOC at 1450'.
9. Pick up tubing to 778'. Mix and pump 380 sxs 15.8#/gal CI G cement down tubing. Cement circulate to surface.
10. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: Valerie Danson

Title: Reg Tech Date: Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Date:

CONDITIONS OF APPROVAL, IF ANY:

COA Type	Description

Attachment List

Att Doc Num	Name
402598599	CEMENT JOB SUMMARY
402598600	OTHER
402598601	OPERATIONS SUMMARY
402598602	WELLBORE DIAGRAM

Total Attach: 4 Files

General Comments

User Group	Comment	Comment Date
		Stamp Upon Approval

Total: 0 comment(s)