

Inspection Photos

2/17/2021

Operator: TEP ROCKY MOUNTAIN LLC - 96850

Location ID: 334601

Garfield County, CO

Aaron Trujillo

NW Reclamation Specialist

COGCC

Inspection Photos

Operator Name: TEP ROCKY MOUNTAIN LLC - 96850

Location ID: 334601



Photo 1: Photo taken from the south end of the Location, facing north. Photos 1-3 provide an overview of the Location from north, northeast to east.



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Inspection Photos

Operator Name: TEP ROCKY MOUNTAIN LLC - 96850

Location ID: 334601



Photo 2: See comments under photo 1.



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Inspection Photos

Operator Name: TEP ROCKY MOUNTAIN LLC - 96850

Location ID: 334601



Photo 3: See comments under photo 1.



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Inspection Photos

Operator Name: TEP ROCKY MOUNTAIN LLC - 96850

Location ID: 334601



Photo 4: Interim reclamation appears to have been recently conducted on the Location. Photo shows vegetation from last growing season is predominantly undesirable annual weedy plant species; Desirable perennial plant establishment not observed.



Inspection Photos

Operator Name: TEP ROCKY MOUNTAIN LLC - 96850

Location ID: 334601



Photo 5: Photo taken from the southeastern interim areas of the Location. Photo shows example of multiple sediment traps installed on the south and eastern ends of the Locaiton.



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Inspection Photos
Operator Name: TEP ROCKY MOUNTAIN LLC - 96850
Location ID: 334601



Photo 6: Photo shows perimeter stormwater ditch and berm to manage stormwater runoff.



Inspection Photos
Operator Name: TEP ROCKY MOUNTAIN LLC - 96850
Location ID: 334601



Photo 7: Photo taken from the north end of the Location. Photo shows perimeter fence is in disrepair.



Inspection Photos
Operator Name: TEP ROCKY MOUNTAIN LLC - 96850
Location ID: 334601



Photo 8: Photo shows fencing panels along wells are in disrepair.

