

FORM  
6Rev  
11/20

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

402630763

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required,

Name:

Tel:

COGCC contact:

Email:

Type of Well Abandonment Report:



Notice of Intent to Abandon



Subsequent Report of Abandonment

API Number 05-123-20276-00

Well Name: OLSON

Well Number: 23-29

Location: QtrQtr: NESW

Section: 29

Township: 4N

Range: 67W

Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.282310

Longitude: -104.916360

GPS Data: GPS Quality Value: 1.2

Type of GPS Quality Value:

Date of Measurement: 07/15/2010

Reason for Abandonment:



Dry



Production Sub-economic



Mechanical Problems

☐ Other

Casing to be pulled:



Yes



No

Estimated Depth:

Fish in Hole:



Yes



No

If yes, explain details below

Wellbore has Uncemented Casing leaks:



Yes



No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7339	7349	01/28/2021	B PLUG CEMENT TOP	7289

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	400	285	400	0	VISU
1ST	7+7/8	4+1/2	J55	10.5	0	7523	160	7523	6520	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7289 with 2 sacks cmt on top. CIBP #2: Depth 6976 with 2 sacks cmt on top.  
 CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set <u>100</u> sks cmt from <u>2555</u> ft. to <u>2300</u> ft.	Plug Type: <u>STUB PLUG</u>	Plug Tagged: <input type="checkbox"/>
Set <u>100</u> sks cmt from <u>1433</u> ft. to <u>1230</u> ft.	Plug Type: <u>OPEN HOLE</u>	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 288 sacks half in. half out surface casing from 605 ft. to 0 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: 2500 ft. of 4+1/2 inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: 7  
 Surface Plug Setting Date: 01/29/2021 Cut and Cap Date: 02/05/2021

\*Wireline Contractor: Rocky Mtn Wireline Services \*Cementing Contractor: DUCO Inc. Cementing Services

Type of Cement and Additives Used: Class G 15.8 PPG Cement

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

#### Technical Detail/Comments:

Olson 23-29 (05-123-20276)/Plugging Procedure  
 Producing Formation: Codell: 7339'-7349'  
 Upper Pierre Aquifer: 470'-1330'  
 TD: 7547' PBTD: 7506' (1/14/2002)  
 Surface Casing: 8 5/8" 24# @ 400' w/ 285 sxs cmt  
 Production Casing: 4 1/2" 10.5# @ 7523' w/ 160 sxs cmt (TOC @ 6520' - CBL)

#### Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 7289'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Codell perms @ 7339')
4. TIH with CIBP. Set BP at 6976'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Niobrara @ 7026')
5. Run a Strip Log from 2800' to Surface (for casing cut verification, log not kept).
6. TIH with casing cutter. Cut 4.5" casing at 2500'. Pull cut casing.
7. TIH with tubing to 2555'. RU cementing company. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Stub plug from 2550'-2300') TOC at 2300'.
8. Wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or fluid migration, contact engineering before continuing operations
9. TIH with tubing to 1433'. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Pierre coverage from 1430'-1230'). TOC at 1230'.
10. Pick up tubing to 605'. Mix and pump 288 sxs 15.8#/gal CI G cement down tubing. Cement circulate to surface.
11. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Valerie Danson

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Date:

CONDITIONS OF APPROVAL, IF ANY:

COA Type	Description

Attachment List

Att Doc Num	Name
402630766	CEMENT JOB SUMMARY
402630767	CEMENT JOB SUMMARY
402630768	OTHER
402630769	OPERATIONS SUMMARY
402630770	WELLBORE DIAGRAM

Total Attach: 5 Files

General Comments

User Group	Comment	Comment Date
		Stamp Upon Approval

Total: 0 comment(s)