

Inspection Photos

3/31/2021

Operator: SG INTERESTS I LTD # 77330

Location ID: 422990

Gunnison County, CO

Aaron Trujillo

NW Reclamation Specialist

COGCC

Inspection Photos
Operator Name: SG INTERESTS I LTD # 77330
Location ID: 422990



Photo 1: Photo taken from the West end of the Location, facing north. Photos 1-3 provide an overview of the Location from west, east to south.

Inspection Photos

Operator Name: SG INTERESTS I LTD # 77330

Location ID: 422990



Photo 2: See comments under photo 1.

Inspection Photos

Operator Name: SG INTERESTS I LTD # 77330

Location ID: 422990



Photo 3: See comments under photo 1.

Inspection Photos
Operator Name: SG INTERESTS I LTD # 77330
Location ID: 422990



Photo 4: Photo taken from the Location, facing northwest. Photo shows cut slopes of the Location. Previous inspection required Operator to implement control measures to stabilize/protect slopes of the Location; BMPs remain missing or insufficient to stabilize/protect slopes of the Location in accordance with Rule 1002.f.(2)C.

Inspection Photos
Operator Name: SG INTERESTS I LTD # 77330
Location ID: 422990



Photo 5: Photo taken from the cut slopes of the Location. Photo shows control measures to stabilize/protect slopes on the Location remain missing or insufficient in accordance with Rule 1002.f.(2)C.

Inspection Photos
Operator Name: SG INTERESTS I LTD # 77330
Location ID: 422990



Photo 6: Photo taken from the cut slopes of the Location. Photo shows control measures to stabilize/protect slopes on the Location remain missing or insufficient in accordance with Rule 1002.f.(2)C.

Inspection Photos
Operator Name: SG INTERESTS I LTD # 77330
Location ID: 422990



Photo 7: Photo taken from the southeast corner of the Location. Photo shows example of slope drain that has not been constructed with an appropriate outlet in accordance with good engineering practices.

Inspection Photos
Operator Name: SG INTERESTS I LTD # 77330
Location ID: 422990



Photo 8: Photo taken from the northeast corner of the Location. Photo shows example of slope drain that has not been constructed with an appropriate outlet in accordance with good engineering practices.