

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

04/01/2021

Submitted Date:

04/02/2021

Document Number:

690201359

FIELD INSPECTION FORMLoc ID 309392 Inspector Name: COSTA, RYAN On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**

OGCC Operator Number: 10672

Name of Operator: TIMBER CREEK OPERATING LLC

Address: 6295 GREENWOOD PLAZA BLVD #100

City: GREENWOOD State: CO Zip: 8111-

Status Summary:

- ☐ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:

4 Number of Comments

2 Number of Corrective Actions

☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
		efitzgerald@ogrisop.com	
		rmack@ogrisop.com	
		timothy.thomsen@state.co.us	
		batwater@ogrisop.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
294301	WELL	PR	07/02/2008	GW	071-09475	APACHE CANYON 1-12	RI
296593	PIT	AC	09/08/2008		-	APACHE CANYON 01-12	AC

General Comment:

This is a location and stormwater management inspection.
See attached photos and additional details within this report.

Location**Lease Road:**

Type			
comment:	See stormwater section.		
Corrective ActionL		Date:	

Overall Good: ☐**Signs/Marker:**

Type	WELLHEAD		
Comment:			
Corrective Action:		Date:	

Emergency Contact Number:

Comment:		Date: _____
Corrective Action:		

Overall Good: ☐**Spills:**

Type	Area	Volume		
------	------	--------	--	--

In Containment: No

Comment: ☐ Multiple Spills and Releases?**Venting:**

Yes/No			
Comment:			
Corrective Action:		Date:	

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Reclamation - Storm Water - Pit**Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment

Comment: There is an area of erosion along the fill slope of the main road. This area needs to be repaired and stabilized. There is vehicle rutting and erosion along the road. The road must be repaired and properly stabilized. BMP's must be implemented in accordance with good engineering practice and must be maintained.

Corrective Action: Install or repair required BMPs per Rule 1002.f.(2)C

Date: 05/14/2021

Pits: ☐ NO SURFACE INDICATION OF PIT

Type: Produced Water Lined: YES Pit ID: 296593 Lat: 37.111040 Long: -104.955500

Reference Point: _____ Other: _____ Length: _____ Width: _____

Lining:

Liner Type: Plastic Liner Condition: Adequate

Comment:

Corrective

Date:

Fencing:

Fencing Type: Wildlife Fencing Condition: Inadequate

Comment: The fence around the pit is not maintained.

Net or fence pit to prevent access per rule 909.f.

Date: 04/16/2021

Corrective Action

Netting:

Netting Type: _____ Netting Condition: _____

Comment:

Corrective

Date:

Anchor Trench Present: _____ Oil Accumulation: NO 2+ feet Freeboard: YES

Comment:

Corrective

Date:

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
402647299	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5393302
690201360	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5393299