

**FORM
INSP**

Rev
X/20

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

05/13/2021

Submitted Date:

05/14/2021

Document Number:

689501246

FIELD INSPECTION FORM

Loc ID _____ Inspector Name: Brown, Kari On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

OGCC Operator Number: 46290
 Name of Operator: KP KAUFFMAN COMPANY INC
 Address: 1675 BROADWAY, STE 2800
 City: DENVER State: CO Zip: 80202

Findings:

- 8 Number of Comments
- 5 Number of Corrective Actions
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
,		mknop@kpk.com	
Canfield, Chris		chris.canfield@state.co.us	
, KPK		cogcc@kpk.com	All Inspections

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
479232	SPILL OR RELEASE	AC			-	Paul Heinze #1 Flowline	EI

General Comment:

This is a follow-up inspection to Doc#689501224; environmental inspection of Spill ID 479232. No changes have occurred at the site since the previous inspection. Any corrective actions from previous inspections that have not been addressed are still applicable.

There were no operator or contract environmental personnel on location at the time of this field inspection.

Photos attached to document site conditions

Location

Overall Good:

Emergency Contact Number:

Comment:

Corrective Action:

Date: _____

Good Housekeeping:

Type	OTHER		
Comment:	Stained soils which appear to be from equipment leaks observed on spill location (see photo 11)		
Corrective Action:	Conduct maintenance on equipment, cleanup stained material and review self inspection processes.	Date:	05/20/2021
Type	TRASH		
Comment:	Trash observed on location		
Corrective Action:	Comply with Rule 606	Date:	05/04/2021

Overall Good:

Spills:

Type	Area	Volume		

In Containment: No

Comment:

Multiple Spills and Releases?

Fencing/:

Type	OTHER		
Comment:	Fencing present around open excavation		
Corrective Action:		Date:	

Venting:

Yes/No			
Comment:			
Corrective Action:		Date:	

Flaring:

Type			
Comment:			
Corrective Action:		Date:	

Inspected Facilities

Facility ID: 479232 Type: SPILL OR API Number: - Status: AC Insp. Status: EI

Environmental

Spills/Releases:

Type of Spill: _____ Estimated Spill Volume: _____

Comment: Spill excavation is open (approx. 60x25x10). Free product observed in contact with groundwater. Soil impacts in situ. Impacted soils are also present on the surface outside the excavation. Initial Form 19 (Doc# 402577378) documents a spill discovery date of 1/17/2021

Corrective Action: In accordance with Rule 912.a.(6) No later than 90 days after a Spill or Release is discovered Operator will submit a Form 19 Supplemental requesting closure pursuant to Rule 913.h and a Form 27 Workplan with a timeline for investigation and closure of this release. Operator will provide notice to COGCC EPS Kari Brown (kari.l.brown@state.co.us) at least 48 hours prior to backfill or any sampling events preformed on location. Note that samples collected must be analyzed for Table 915-1 parameters.

Date: 04/17/2021

Reportable: _____ GPS: Lat _____ Long _____
 Proximity to Surface Water: _____ Depth to Ground Water: _____

Water Well Complaint:

DWR Receipt Num: _____ Owner Name: _____ GPS : _____ Lat _____ Long _____

Field Parameters:

Sample Location: _____ Comment: _____

Waste Management:

Type	Management	Condition	GPS (Lat)	(Long)	
Oily Soil	Piles	Inadequate			
Comment		Approx 80 cu yd of impacted material remain stored on location. Stockpiled soils on location are not labeled or lined and BMP's are not adequate for size of stockpile			
Corrective Action		Manage waste in compliance with Rule 913.b.iv and COGCC Guidance 913.b.(5)B i-v.			Date: <u>03/03/2021</u>

Spill/Remediation:

Comment: Free product was observed in contact with groundwater on 2/22/2021; free product has not been removed and is still visible on groundwater in open excavation

Corrective Action: Remove free product from excavation in accordance with Rule 912.a.(2). Date: 02/26/2021

Emission Control Burner (ECB): _____

Comment: _____

Pilot: _____ Wildlife Protection Devices (fired vessels): _____

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
689501247	Inspection photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5429447