

Document Number:  
402680007

Date Received:  
05/05/2021

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120 Contact Name: CANDICE BARBER  
 Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP Phone: (307) 233-4513  
 Address: P O BOX 173779 Fax: \_\_\_\_\_  
 City: DENVER State: CO Zip: 80217- Email: CANDICE\_BARBER@OXY.COM

**For "Intent" 24 hour notice required,** Name: Carlile, Craig Tel: (970) 629-8279  
 COGCC contact: Email: craig.carlile@state.co.us

Type of Well Abandonment Report:  Notice of Intent to Abandon  Subsequent Report of Abandonment

API Number 05-123-20023-00  
 Well Name: HSR-MILLER Well Number: 3-33A  
 Location: QtrQtr: NENW Section: 33 Township: 3N Range: 66W Meridian: 6  
 County: WELD Federal, Indian or State Lease Number: \_\_\_\_\_  
 Field Name: WATTENBERG Field Number: 90750

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.187410 Longitude: -104.784800  
 GPS Data: GPS Quality Value: 2.7 Type of GPS Quality Value: PDOP Date of Measurement: 10/19/2006

Reason for Abandonment:  Dry  Production Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_

Casing to be pulled:  Yes  No Estimated Depth: 770  
 Fish in Hole:  Yes  No If yes, explain details below  
 Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below  
 Details: \_\_\_\_\_

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
J SAND	7782	7852			
Total: 1 zone(s)					

**Casing History**

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	667	470	667	0	VISU
1ST	7+7/8	4+1/2	I-80	11.6	0	7967	250	7967	6660	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7700 with 2 sacks cmt on top. CIBP #2: Depth 7000 with 2 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 10 sks cmt from 1560 ft. to 1435 ft. Plug Type: CASING Plug Tagged:   
Set 16 sks cmt from 50 ft. to 0 ft. Plug Type: CASING Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:

Perforate and squeeze at 2000 ft. with 215 sacks. Leave at least 100 ft. in casing 1560 CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 120 sacks half in. half out surface casing from 770 ft. to 617 ft. Plug Tagged:

Set 16 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_  
Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105  Yes  No

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: CANDICE BARBER

Title: REGULATORY ANALYST Date: 5/5/2021 Email: RSCDJPOSTDRILL@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Haverkamp, Curtis Date: 5/17/2021

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_ Expiration Date: 11/16/2021

## Condition of Approval

**COA Type**

**Description**

	<p>Prior to commencing operations, at a minimum, the operator will provide an informational sheet to the BUs that are adjacent to the parcel on which the well is located. The sheet will include the operator's contact information and the nature and timing of the P&amp;A operations.</p>
	<p>Prior to starting plugging operations a bradenhead test shall be performed if there has not been a reported bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the COGCC within three (3) months of collecting the samples.</p> <p>If there is a need for sampling, contact COGCC engineering for verification of plugging procedure.</p>
	<p>Well last produced Apr-2020. Successful MIT to be performed by Apr-2022 if not plugged by then.</p>
	<p>1) Provide 2 business day notice of plugging MIRU via electronic Form 42.</p> <p>2) After placing the shallowest hydrocarbon isolating plug (7000'), operator must wait a sufficient time to confirm static conditions.</p> <p>3) After placing plug at 2000' assure that all fluid migration has been eliminated by monitoring the well for a minimum of 8 hours before proceeding to the next plug. If at any time after placing this plug there is evidence of pressure or of fluid migration, contact COGCC engineering before continuing operations.</p> <p>4) Prior to placing the 770' plug: verify that all fluid migration (liquid or gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>5) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 617' or shallower and provide at least 10 sx plug at the surface.</p> <p>6) Leave at least 100' of cement in the wellbore for each plug.</p> <p>7) Properly abandon flowlines as per Rule 1105. Pursuant to Rule 911.a. Closure of Oil and Gas Facilities, Operator will submit Site Investigation and Remediation Workplans via Form 27 for COGCC prior approval before cutting and capping the plugged well, conducting flowline abandonment, and removing production equipment. Pursuant to Rule 1105.f. Abandonment Verification, within 90 days of an operator completing abandonment requirements for a flowline or crude oil transfer line, an operator must submit a Field Operations Notice, Form 42-Abandonment of Flowlines for on-location flowlines, and a Flowline Report, Form 44, for off-location flowlines or crude oil transfer lines.</p> <p>8) With the Form 6 SRA operator must provide written documentation which positively affirms each COA has been addressed.</p>
	<p>Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.</p>
	<p>In accordance with the Notice to Operators (NTO): Timing for COGCC Forms adopted on 05/01/2020, this Form 6 Notice of Intent to Abandon is valid for 12 months from the date of approval expiring on 05/17/2022. This NTO does not alter the deadlines for submission of, or compliance with any other Commission rule or Form.</p>

6 COAs

### Attachment List

<u>Att Doc Num</u>	<u>Name</u>
402680007	FORM 6 INTENT SUBMITTED
402680018	PROPOSED PLUGGING PROCEDURE
402680019	WELLBORE DIAGRAM

Total Attach: 3 Files

### General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Engineer	DWR base Fox Hills: 577' Deepest water well within 1 mile: 635'	05/17/2021
Permit	-Confirmed as-drilled well location. -No other forms in process. -Production reporting up-to-date. -Confirmed productive interval docnum: 867053. -Reviewed WBD and procedure. -Pass.	05/05/2021

Total: 2 comment(s)