

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

05/21/2021

Submitted Date:

05/25/2021

Document Number:

696202716

FIELD INSPECTION FORMLoc ID 418697 Inspector Name: Trujillo, Aaron On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**

OGCC Operator Number: 77330

Name of Operator: SG INTERESTS I LTD

Address: 100 WAUGH DR SUITE 400

City: HOUSTON State: TX Zip: 77007

Status Summary:

- ☒ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:

5 Number of Comments

2 Number of Corrective Actions

- ☒ Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
,		dnr_cogccenforcement@state.co.us	
,		inspection@sginterests.com	All Inspections

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
418693	WELL	PA	07/11/2019	GW	051-06098	VOLK 12-89-21 #1	RI
418697	LOCATION	CL			-	VOLK 12-89-21 #1	RI

General Comment:

On 05/21/2021, Reclamation Specialist Trujillo conducted a final reclamation and stormwater inspection at SG Interests' Volk 12-89-21 #1 location in Gunnison County, Colorado.

This inspection is also a followup to:

#696201320 dated 5/26/2020;
 #696201669 dated 8/31/2020;
 #696202023 dated 1/19/2020;
 #696202524 dated 3/31/2021;
 and #696202652 dated 5/6/2021;

to document compliance with the following corrective actions:
 1002.f.(2)C: Stormwater

It was observed in this inspection that the Location remains out of compliance with COGCC Rules and corrective actions.

The following additional compliance issues were also observed:
 1004.e: Weed control

Refer to the "Stormwater" and "Good Housekeeping" sections of this inspection report for additional details.

Refer to the photo-documentation of the observed compliance issues attached to this report.

Any corrective action(s) from previous inspections that have not been addressed are still applicable.

A follow up on this site inspection will be conducted to ensure the compliance issues have been corrected to comply with COGCC rules.

LocationOverall Good: ☐

Emergency Contact Number:

Comment: Corrective Action: Date: **Good Housekeeping:**

Type	WEEDS		
Comment:	Noxious weed (Canada thistle, houndstongue, musk thistle) rosettes observed on the cut and fill slopes of the Location.		
Corrective Action:	Comply with Rule 1004.e		Date: 06/08/2021

Overall Good: ☐**Spills:**

Type	Area	Volume		
------	------	--------	--	--

In Containment: No

Comment: ☐ Multiple Spills and Releases?**Venting:**

Yes/No			
Comment:			
Corrective Action:		Date:	

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Inspected Facilities									
Facility ID:	418693	Type:	WELL	API Number:	051-06098	Status:	PA	Insp. Status:	RI
Facility ID:	418697	Type:	LOCATION	API Number:	-	Status:	CL	Insp. Status:	RI

Reclamation - Storm Water - Pit**Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment

Comment: [See "COGCC Comments" for comments regarding stormwater.](#)

Corrective Action: **Install or repair required BMPs in accordance with good engineering practices per Rule 1002.f.(2)C. Conduct revegetation/reseeding activities on the slopes and install erosion controls to stabilize the seeded soil.**

Date: 06/11/2020

Pits: ☐ NO SURFACE INDICATION OF PIT

COGCC Comments

Comment	User	Date
<p>STORMWATER COMMENTS</p> <p>Previous inspection observed that stormwater and erosion control measures on the Location were insufficient, or missing in accordance with Rule 1002.f.(2)C. Inspections required Operator to comply with Rule 1002.f.(2)C, and to conduct revegetation/reseeding activities on the disturbed areas/slopes of the Location by 6/11/2020; BMPs to stabilize the seeded soils were also required.</p> <p>It was observed in this inspection that the Location remains out of compliance with COGCC Rules and corrective actions; stormwater diversion ditch constructed along the perimeter of the Location, including armoring and outlets, is inadequate for site's conditions or not maintained in proper functioning condition; silt fence on west end of the Location not maintained in proper functioning condition; unable to find evidence that revegetation activities have been performed on disturbed areas and control measures to stabilize/protect slopes and seeded soils remain missing or insufficient.</p> <p>Original corrective action has not been addressed in its entirety, and remains applicable.</p>	trujilloam	05/25/2021

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
696202717	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5440604