

FORM
6Rev
11/20

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

402706737

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required,

Name: Santistevan, Brittani

Tel: (720) 471-1110

COGCC contact:

Email: brittani.santistevan@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-20018-00

Well Name: HANKINS

Well Number: 22-41

Location: QtrQtr: NESE Section: 22 Township: 5N Range: 67W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.383404

Longitude: -104.872566

GPS Data: GPS Quality Value: 4.4 Type of GPS Quality Value: Date of Measurement: 03/02/2007

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes ☒ No Estimated Depth:Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7218	7234			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	397	280	397	0	VISU
1ST	7+7/8	4+1/2	J55	11.6	0	7368	775	7368	115	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7168 with 2 sacks cmt on top. CIBP #2: Depth 6939 with 2 sacks cmt on top.
CIBP #3: Depth 2500 with 2 sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 105 ft. with 23 sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 111 sacks half in. half out surface casing from 1460 ft. to 0 ft. Plug Tagged: ☒

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Surface Plug Setting Date: _____ Cut and Cap Date: _____ Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____

*Wireline Contractor: _____

*Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Hankins 22-41 (05-123-20018)/Plugging Procedure (Intent)
Producing Formation: Codell: 7218'-7234'

Upper Pierre Aquifer: 350'-1360'

TD: 7371' PBTD: 7333' (6/3/00)

Surface Casing: 8 5/8" 24# @ 397' w/ 280 sxs cmt

Production Casing: 4 1/2" 11.6# @ 7368' w/ 775 sxs (TOC @ 115' - CBL)

Tubing: 2 3/8" Tubing @ 7193' (5/23/06)

Proposed Procedure:

1. MIRU pulling unit. Pull 2-3/8" Tubing.

2. RU wireline company.

3. TIH with CIBP. Set BP at 7168'. Top with 2 sx 15.8#/gal CI G cement. (Top of Codell perms @ 7218')

4. TIH with CIBP. Set BP at 6939'. Top with 2 sx 15.8#/gal CI G cement. (Top of Niobrara @ 6989')

5. TIH with CIBP. Set BP at 2500'. Top with 2 sx 15.8#/gal CI G cement.

6. Run a CBL from 2400' to Surface (for perf shot verification, Confirm TOC @ 115').

7. TIH with perf gun. Shoot holes at 105'.

8. TIH with tubing to 1460'. RU cementing company. Mix and pump 111 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.

9. Close off casing returns. Hook up cement line to cement flange and pump 23 sxs 15.8#/gal CI G cement downhole and squeeze through perms at 105' into annular space. Cement should circulate to surface.

10. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Valerie Danson
Title: Reg Tech Date: _____ Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: _____

COA Type **Description**

--	--

Attachment List

Att Doc Num **Name**

402706748	WELLBORE DIAGRAM
402706749	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group **Comment** **Comment Date**

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)