

Federal 9-1-10-100
NESW Section 9 T10S R100W 6 PM
Persigo Wash Field Mesa County, CO.
COC13656
API #05-077-08018
6/2021

1. MIRU. Excavate surface casinghead and monitor during operations.
2. POOH with tubing.
3. Set a 4½" CIBP at 2748'. Spot 50' of cement on top of plug.
4. Pressure test 4½" casing to 300 psig for 15 minutes. Contact Stephen Garcia (BLM) and Aaron Katz (COGCC) for additional plugging requirements if pressure test is unsuccessful.
5. Perforate the 4½" casing at 247'.
6. Mix and pump 30 sacks of 15.6 ppg cement. Place 100' of cement in the 4½" X 7¾" annulus from 247' to 147' and 100' of cement inside the 4½" casing from 247' to 147'.
7. WOC. Tag cement. Spot additional cement if top is below 147'
8. Excavate and cut off casing 4' below grade.
9. Top out the 4½" casing and the 4½" X 7¾" annulus with cement from 50' back to surface. Estimate 20 sacks.
10. Weld a steel marker plate with weep hole onto the casing stub. The marker plate is to be inscribed with the following information:

Maralex Resources Inc
Vision Energy LLC
Federal 9-1
NESW 9 10S 100W
COC13656
0507708018