

Document Number:
402791159

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Valerie Danson
 Name of Operator: PDC ENERGY INC Phone: (970) 506-9272
 Address: 1775 SHERMAN STREET - STE 3000 Fax: _____
 City: DENVER State: CO Zip: 80203 Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required, Name: Evins, Bret Tel: (970) 420-6699
COGCC contact: Email: bret.evins@state.co.us

Type of Well Abandonment Report: Notice of Intent to Abandon Subsequent Report of Abandonment

API Number 05-123-22683-00
 Well Name: J&L FARMS Well Number: 31-19
 Location: QtrQtr: NWNE Section: 19 Township: 6N Range: 63W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.477780 Longitude: -104.478030
 GPS Data: GPS Quality Value: 1.6 Type of GPS Quality Value: _____ Date of Measurement: 06/13/2008

Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____

Casing to be pulled: Yes No Estimated Depth: _____
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	6624	6805			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	453	360	453	0	VISU
1ST	7+7/8	4+1/2	J55	10.5	0	6992	500	7001	2498	CBL
S.C. 1.1						2474	400	2474	0	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6574 with 2 sacks cmt on top. CIBP #2: Depth 2400 with 2 sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 (Cast Iron Cement Retainer Depth)

Set 125 sacks half in. half out surface casing from 1610 ft. to 0 ft. Plug Tagged:
 Set _____ sacks at surface
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
 Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____
 Surface Plug Setting Date: _____ Cut and Cap Date: _____
 *Wireline Contractor: _____ *Cementing Contractor: _____
 Type of Cement and Additives Used: _____
 Flowline/Pipeline has been abandoned per Rule 1105 Yes No

Technical Detail/Comments:

J & L Farms 31-19 (05-123-22683) / Plugging Procedure (Intent)
 Producing Formations: Niobrara/Codell: 6624'-6805'

Upper Pierre Aquifer: 470'-1510'

Deepest Water Well: 400'
 TD: 7001' PBD: 6978.7' (2/25/2005)
 Surface Casing: 8 5/8" 24# @ 453' w/ 360 sxs cmt
 Production Casing: 4 1/2" 10.5# @ 6992' w/ 500 sxs (TOC @ 2498' - CBL)
 Annular Fill @ 2474' w/ 400 sxs (TOC @ Surface - CBL)

Tubing: 2 3/8" landed @ 6783.39' (7/30/2015)

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6574'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Nio perms @ 6624')
4. TIH with CIBP. Set BP at 2400'. Top with 2 sxs 15.8#/gal CI G cement.
5. Wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or fluid migration, contact engineering before continuing operations.
6. TIH with tubing to 1610'. RU cementing company. Mix and pump 125 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
7. Well casing cut and capped per COGCC guidelines at a depth as not to interfere with soil cultivation.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Valerie Danson

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: _____

COA Type	Description

Attachment List

Att Doc Num	Name
402791175	WELLBORE DIAGRAM
402791176	WELLBORE DIAGRAM
402791177	GYRO SURVEY

Total Attach: 3 Files

General Comments

User Group	Comment	Comment Date
		Stamp Upon Approval

Total: 0 comment(s)