

# Emerald 117

## MULTI-DAY JOB SUMMARY

API: 103-40249

SWSE Sec 6 T1N R102W

### Job Reports (Daily Summary)

WELL: EMERALD 117

REPORT: DAILY DRILLING

REPORT START	REPORT END	OPERATIONS SUMMARY	
08/27/21 06:00 AM	08/28/21 06:00 AM	Traveled to location, Held TGSM & Reviewed JSA for todays procedure. Verfiy cement top is @ 8' from surface. Meet COGCC, check with LEL meters, no gas detected; dig around csg to depth of 8', cut off csg & top off cement to 4' from surface, weld on ID plate; take pictures, will leave area open for 5 days as per COGCC rules, prep area for soil testing. Start cleaning up location SDFN.	<a href="#">View</a>
08/26/21 06:00 AM	08/27/21 06:00 AM	Traveled to location, Held TGSM & Reviewed JSA for todays procedure. RU TD machine, verify cement top @ 149'; RIH with 2-3/8"tbg. Set up to run 2-3/8" tbg. TIH with 2-3/8" pipe hang pipe off @135'. Lay out hard line and pressure test equipment and line to 500 psi. held ok. Pumped 1 bbls of fresh water then started pumping cement (ASTM "C" ) pumped 92 sacks of cement. Cement shown at 8' from surface, flushed tbg. TOOH laying down tbg. flush equipment, break down hard line; SDFN.	<a href="#">View</a>
08/25/21 06:00 AM	08/26/21 06:00 AM	Traveled to location, Held TGSM & Reviewed JSA for todays procedure. R/U TD machine RIH found Cement top TD @435' POOH rig down TD machine. Started funneling in shale and rock mix, funneled in approx 8 yards of material, let settle for 30 min. RIH TD @ 149', POOH rig down conveyor. SDFN.	<a href="#">View</a>
08/24/21 06:00 AM	08/25/21 06:00 AM	Traveled to location, Held TGSM & Reviewed JSA for todays procedure. R/U TD machine RIH found TD still @589' POOH rig down TD machine. Lay out hard line and pressure test equipment and line to 500 psi. held ok. Pumped 2bbls of fresh water then started pumping cement (ASTM "C" ) pumped 102 sacks of cement, flushed tbg. TOOH laying down tbg. flush equipment, break down hard line. RU conveyor, haul in 2 loads of rock & shale mix. SDFN.	<a href="#">View</a>
08/23/21 06:00 AM	08/24/21 06:00 AM	Traveled to location, Held TGSM & Reviewed JSA for todays procedure. Set up equipment R/U TD machine TD @786' POOH, Conveyed rock mix into well. Funnel approx. 3.5 yards; R/U TD machine found top of rock mix plug at 1185' rock mix plug had fell and stacked out, continued funneling rock mix to a depth of 589'Approx: 11 yards of rock mix; TIH with 2 3/8" tbg to a depth of 560'. Rigged down conveyor. SDFN.	<a href="#">View</a>
08/20/21 06:00 AM	08/21/21 06:00 AM	Traveled to location, Held TGSM & Reviewed JSA for todays procedure. Casing Pressure 0 psi. Contacted Aaron Katz with COGCC to let him know we will be starting on the P&A . Conformation email was sent. Hauled in 2 loads of Rock and Shale mix, install cellar ring, built berm around well bore; hauled in cement equipment, Conveyor , Hyd. Unit, weatherford equipment, 2-3/8" tubing.	<a href="#">View</a>