

FORM  
6Rev  
11/20

# State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

402818247

Date Received:

09/21/2021

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: Ben Hollar

Name of Operator: NOBLE ENERGY INC

Phone: (303) 548-7447

Address: 1001 NOBLE ENERGY WAY

Fax:

City: HOUSTON State: TX Zip: 77070

Email: ben.hollar@chevron.com

For "Intent" 24 hour notice required,

Name: Evins, Bret

Tel: (970) 420-6699

COGCC contact:

Email: bret.evins@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-18536-00

Well Name: WARDLAW

Well Number: 35-21

Location: QtrQtr: NENW Section: 35 Township: 6N Range: 64W Meridian: 6

County: WELD Federal, Indian or State Lease Number: 60595

Field Name: WATTENBERG Field Number: 90750

### Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.447715 Longitude: -104.519664

GPS Data: GPS Quality Value: 4.8 Type of GPS Quality Value: PDOP Date of Measurement: 01/25/2007

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes ☐ No Estimated Depth: 1001Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

### Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6802	6812			
NIOBRARA	6684	6764			

Total: 2 zone(s)

### Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	395	270	395	0	VISU
1ST	7+7/8	4+1/2	HC-95	15.1	0	6912	155	6912	5912	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6634 with 2 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 30 sks cmt from 2398 ft. to 2000 ft. Plug Type: CASING Plug Tagged: ☐  
Set 95 sks cmt from 295 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☒  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 2500 ft. with 155 sacks. Leave at least 100 ft. in casing 2398 CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 270 sacks half in. half out surface casing from 1001 ft. to 295 ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_  
Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Stephanie Dionne  
Title: Operations Tech Date: 9/21/2021 Email: stephanie.dionne@chevron.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: JENKINS, STEVE Date: 10/4/2021

CONDITIONS OF APPROVAL, IF ANY:

Expiration Date: 4/3/2022

### Condition of Approval

#### COA Type

#### Description

	Operator will provide notice to Residential Building Unit residents within 1,000 feet of the well.
	Submit Operator's Monthly Production Reports (Form 7) required for compliance with Rule 413 within 30 days: NB-CD 7/2010 and 1/2012
	<p>Prior to starting plugging operations a Bradenhead test shall be performed if there has not been a reported Bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the COGCC within three (3) months of collecting the samples.</p>
	Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.
	<p>1) Provide 48 hours notice of plugging MIRU via electronic Form 42.</p> <p>2) After placing the shallowest hydrocarbon isolating plug (2398'), operator must wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or of fluid migration, contact COGCC engineering before continuing operations.</p> <p>3) Prior to placing the 1001' plug: verify that all fluid migration (liquid and gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>4) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 345' or shallower and provide 10 sx plug at the surface.</p> <p>5) Leave at least 100' of cement in the wellbore for each plug.</p> <p>6) Properly abandon flowlines as per Rule 1105. Pursuant to Rule 911.a. Closure of Oil and Gas Facilities, Operator will submit Site Investigation and Remediation Workplans via Form 27 for COGCC prior approval before cutting and capping the plugged well, conducting flowline abandonment, and removing production equipment. Pursuant to Rule 1105.f. Abandonment Verification, within 90 days of an operator completing abandonment requirements for a flowline or crude oil transfer line, an operator must submit a Field Operations Notice, Form 42-Abandonment of Flowlines for on-location flowlines, and a Flowline Report, Form 44, for off-location flowlines or crude oil transfer lines.</p> <p>7) With the Form 6 SRA operator must provide written documentation which positively affirms each COA has been addressed.</p>

5 COAs

### Attachment List

#### Att Doc Num

#### Name

402818247	FORM 6 INTENT SUBMITTED
402818280	WELLBORE DIAGRAM
402818281	WELLBORE DIAGRAM

Total Attach: 3 Files

### General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
OGLA	OGLA review complete.	10/04/2021
Engineer	In accordance with the Notice to Operators (NTO): Timing for COGCC Forms adopted on 05/01/2020, this Form 6 Notice of Intent to Abandon is valid for 12 months from the date of approval expiring on 9/24/2022. This NTO does not alter the deadlines for submission of, or compliance with any other Commission rule or Form.	09/24/2021
Engineer	1) Deepest Water Well within 1 mile = 800'. 2) Fox Hills Bottom- N/A, per SB5.	09/24/2021
Permit	Verified as-drilled GPS. Verified perf zones. Form 7s missing for 7/2010 and 1/2012 COA placed Permitting review complete.	09/24/2021

Total: 4 comment(s)