

**FORM  
INSP**Rev  
X/20**State of Colorado  
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

11/01/2021

Submitted Date:

11/04/2021

Document Number:

696203346

**FIELD INSPECTION FORM**Loc ID 335950 Inspector Name: Trujillo, Aaron On-Site Inspection ☐ 2A Doc Num: \_\_\_\_\_**Operator Information:**

OGCC Operator Number: 10433

Name of Operator: LARAMIE ENERGY LLC

Address: 1001 17TH STREET #1900

City: DENVER State: CO Zip: 80202

**Status Summary:**

- ☒ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

**Findings:**

3 Number of Comments

1 Number of Corrective Actions

- ☒ Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM  
PREVIOUS INSPECTIONS THAT HAVE NOT  
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
, Laramie		cogccnotifications@laramie-energy.com	<a href="#">All Inspections</a>

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
335950	LOCATION	AC			-	CC 0697-16A2 Pad	RI

**General Comment:**

On 11/1/2021 Reclamation Specialist Trujillo conducted a stormwater inspection at Laramie Energy's CC 0697-14A2 Pad location in Garfield County, Colorado.

The inspection is a followup to #696203158 to document compliance with the following corrective actions:  
1002.f: Stormwater

It was observed that the Location remains out of compliance with COGCC Rules and corrective actions.

Refer to the "Stormwater" section of this inspection report for additional details.

Refer to the photo-documentation of the observed compliance issues attached to this report.

Any corrective action(s) from previous inspections that have not been addressed are still applicable.

A follow up inspection on this site will be conducted to ensure the compliance issues have been corrected to comply with COGCC rules.



**Reclamation - Storm Water - Pit****Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment

Comment: Inspection #696203158 observed gully erosion due to stormwater runoff from the Location, on the north end of the site; stormwater and erosion control measures inadequate to control runoff from the Location in a manner that minimizes erosion and site degradation per good engineering practices.

It was observed in this inspection that work to repair/stabilize gulley erosion and address runoff from the Location is inadequate; Operator has installed erosion logs into the gulley erosion; velocity checks alone insufficient to manage runoff from the Location, to allow for proper stormwater discharge, and to minimize erosion degradation per good engineering practices. Additional erosion degradation and sediment transport is evident at the gulley.

Corrective Action: Original corrective action and date remains applicable.

Comply with Rule 1002.f

Date: 09/21/2021

Pits: ☐ NO SURFACE INDICATION OF PIT

**Attached Documents**

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
696203347	Inspection Photos	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5572632">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5572632</a>