

Inspection Photos

11/19/2021

Operator: TEP ROCKY MOUNTAIN LLC #96850

Location ID: 335542

Garfield County, CO

Aaron Trujillo

NW Reclamation Specialist

COGCC

Inspection Photos

Operator Name: TEP ROCKY MOUNTAIN LLC #96850

Location ID: 335542



November 19, 2021
39.5291772N 107.64657657W



November 19, 2021
39.52915955N 107.64658228W

Photo 1: Photos shows fence and cover at cellar has been replaced; plate placed onto conductor pipe. Wildlife ramp installed.



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Inspection Photos
Operator Name: TEP ROCKY MOUNTAIN LLC #96850
Location ID: 335542



Photo 2: Photos provide examples of the cut slopes on the Location; control measures to protect and stabilize the cut slopes remain missing or insufficient per good engineering practices; erosion degradation evident.

Inspection Photos
Operator Name: TEP ROCKY MOUNTAIN LLC #96850
Location ID: 335542



Photo 3: Photos provide examples of the cut slopes on the Location; control measures to protect and stabilize the cut slopes remain missing or insufficient per good engineering practices; erosion degradation evident.

Inspection Photos
Operator Name: TEP ROCKY MOUNTAIN LLC #96850
Location ID: 335542



Photo 4: Photos show undesirable plant species / weed debris has not been removed from the Location per corrective actions.

Inspection Photos
Operator Name: TEP ROCKY MOUNTAIN LLC #96850
Location ID: 335542



November 19, 2021
39.52924855N 107.64668146W

Photo 7: Photo shows stormwater outlet on the northwest end of the Location. Erosion degradation at outlet on the northwest end of the Location has been repaired; outlet has been reinstalled with use of geotextile lining, though Operator has used smooth rocks (such as river stone) rather than angular rock material per good engineering; smooth stones will accelerate stormwater, where as angular rock will dissipate velocity. No other controls have been implemented in conjunction with the outlet to allow for sediment laden-free stormwater discharge; unclear if outlet alone will be adequate to allow for proper stormwater discharge from the Location.