

FORM  
6Rev  
11/20

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

402893566

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: valerie.danson@pdce.com

**For "Intent" 24 hour notice required,**

Name: Santistevan, Brittani

Tel: (720) 471-1110

**COGCC contact:**

Email: brittani.santistevan@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-16521-00

Well Name: SEELEY LAKE

Well Number: 3

Location: QtrQtr: NESW Section: 24 Township: 6N Range: 66W Meridian: 6

County: WELD Federal, Indian or State Lease Number: 59859

Field Name: BRACEWELL Field Number: 7487

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.472188 Longitude: -104.727614

GPS Data: GPS Quality Value: 2.1 Type of GPS Quality Value: Date of Measurement: 01/21/2010

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes ☐ No Estimated Depth: 2500Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

## Current and Previously Abandoned Zones

| Formation | Perf. Top | Perf. Btm | Abandoned Date | Method of Isolation | Plug Depth |
|-----------|-----------|-----------|----------------|---------------------|------------|
| CODELL    | 7102      | 7112      |                |                     |            |

Total: 1 zone(s)

## Casing History

| Casing Type | Size of Hole | Size of Casing | Grade | Wt/Ft | Csg/Liner Top | Setting Depth | Sacks Cmt | Cmt Btm | Cmt Top | Status |
|-------------|--------------|----------------|-------|-------|---------------|---------------|-----------|---------|---------|--------|
| SURF        | 12+1/4       | 8+5/8          | J55   | 24    | 0             | 387           | 275       | 387     | 0       | VISU   |
| 1ST         | 7+7/8        | 4+1/2          | J55   | 11.6  | 0             | 7219          | 175       | 7219    | 6356    | CBL    |

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7052 with 2 sacks cmt on top. CIBP #2: Depth 6746 with 2 sacks cmt on top.  
 CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 100 sks cmt from 2550 ft. to 2300 ft. Plug Type: STUB PLUG Plug Tagged: ☐  
 Set 100 sks cmt from 1540 ft. to 1340 ft. Plug Type: OPEN HOLE Plug Tagged: ☐  
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 353 sacks half in. half out surface casing from 640 ft. to 0 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_  
 Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Seeley Lake 3 (05-123-16521) / Plugging Procedure (Intent)  
 Producing Formation: Codell: 7102'-7112'

Upper Pierre Aquifer: 440'-1440'

Deepest Water Well: 328'

TD: 7250' PBTD: 7192' (12/22/1998)

Surface Casing: 8 5/8" 24# @ 387' w/ 275 sxs cmt

Production Casing: 4 1/2" 11.6# @ 7219' w/ 175 sxs (TOC @ 6356' - CBL)

Tubing: 2 3/8" 4.7# set @ 7078' (12/30/1998)

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 7052'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Codell perfs @ 7102')
4. TIH with CIBP. Set BP at 6746'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Niobrara @ 6796')
5. TIH with casing cutter. Cut 4 1/2" casing @ 2500'. Pull cut casing.
6. TIH with tubing to 2550'. RU cementing company. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Stub Plug from 2550'-2300')
7. Wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or fluid migration, contact engineering before continuing operations.
8. TIH with tubing to 1540'. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Pierre Coverage from 1540'-1340')
9. Pick up with tubing to 640'. Mix and pump 353 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
10. Well casing cut and capped per COGCC guidelines at a depth as not to interfere with soil cultivation.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Valerie Danson  
Title: Reg Tech Date: \_\_\_\_\_ Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_ Expiration Date: \_\_\_\_\_

**COA Type** **Description**

|  |  |
|--|--|
|  |  |
|--|--|

**Attachment List**

**Att Doc Num** **Name**

|           |                  |
|-----------|------------------|
| 402893567 | WELLBORE DIAGRAM |
| 402893568 | WELLBORE DIAGRAM |

Total Attach: 2 Files

**General Comments**

**User Group** **Comment** **Comment Date**

|  |  |                     |
|--|--|---------------------|
|  |  | Stamp Upon Approval |
|--|--|---------------------|

Total: 0 comment(s)