

Bison Oil and Gas II, LLC
Nay 1
Capital - Offset Well Remediation (P&A)

Lat 40.752405

Long -103.829955

PROCEDURE

1. Survey and locate abandoned well. Mark with stake and record as-drilled GPS coordinates.
2. Excavate to expose top of surface casing. Cut plate off. Weld 10-3/4" slip collar, sufficient 10-3/4" casing to reach ground level, and 10-3/4" slip collar.
3. MIRU workover rig. NU wellhead and 5k BOP. Test BOP.
4. PU and RIH with 4-7/8" tricone bit, 10 3-1/2" drill collars, and 2-7/8", 6.5#, L80, EUE workstring and circulate hole clean.
5. Continue drilling or RIH to top of surface casing plug. Record depth of plug. Pressure test surface casing to 250 psi. If surface casing fails pressure test, contact engineer.
6. After pressure test of surface casing, drill out surface casing plug. If pressure is encountered below surface casing plug, circulate hole with mud or kill fluid until well is dead or blown down.
7. PU and SLOWLY RIH with mule shoe and 2-7/8" L80 tubing to top of cement. Record top of casing and contact engineer.
8. RU cement crew, pressure test lines to 4,500 psi, and pump a balanced plug of 65 sks 15.8 ppg Class G neat cement at the top of the casing. IF CIRCULATION IS NOT MAINTAINED WHILE PUMPING PLUG AND DISPLACING TO DEPTH: POOH to surface casing. Wait 4 hours and tag TOC. Record tag depth. If tag is less than 100' above casing, contact engineer.
8. POOH to 1650'. RU cement crew and pump a balanced plug of 65 sks 15.8 ppg Class G neat cement at 1650'. POOH to surface casing. Wait 4 hours and tag TOC. Record tag depth. If tag is deeper than 1500', contact engineer.
10. POOH to 400'. RU cement crew and pump 196 sks of 15.8 ppg Class G neat cement and bring cement to surface. POOH with 2-7/8" tubing. RDMO. Top off cement after rig has moved, if necessary.
11. Once surface plug has set, cut casing to 5' below ground level and weld on a plate to seal the well. Inscribe the well's legal location, well name and number, and API number on the plate, as shown below.

2310' FNL, 2310' FEL, SWNE Sec 14, T9N, R58W
Nay 1
05-123-05660

12. Photograph welded name plate and send to engineer and state inspector before proceeding.
13. Backfill hole and reclaim surface to original conditions.

CEMENT PLUG TABLE							
Plug Number	Plug Status	Formation	Plug Bottom Depth	Plug Top Depth	Cement Class	Yield (ft ³ /sk)	Number of Sacks
1	Existing	D & J Sand	6213'	est. 5899'	Unknown	Unknown	est. 50
2	New	Niobrara	5000'	4850'	G	1.15	65
3	New	Pierre	1650'	1500'	G	1.15	65
4	New	Fresh Water	400'	Surface	G	1.15	196
TOTAL NEW SKS OF CEMENT REQUIRED:							326