

FORM

6

Rev
11/20

State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Replug By Other Operator

Document Number:

402909869

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 10454

Contact Name: Cal St. John

Name of Operator: PETROSHARE CORPORATION

Phone: (720) 545-5624

Address: 9635 MAROON CIRCLE #400

Fax:

City: ENGLEWOOD State: CO Zip: 80112

Email: cal.stjohn@state.co.us

For "Intent" 24 hour notice required,

Name: Medina, Justin

Tel: (720) 471-0006

COGCC contact:

Email: justin.medina@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-001-08362-00

Well Name: (UPRR) KALCEVIC (OWP)

Well Number: 22-3

Location: QtrQtr: SENW Section: 3 Township: 2S Range: 63W Meridian: 6

County: ADAMS

Federal, Indian or State Lease Number:

Field Name: CHIEFTAIN

Field Number: 11060

Only Complete the Following Background Information for Intent to Abandon

Latitude: 39.906780 Longitude: -104.425600

GPS Data: GPS Quality Value: 2.5 Type of GPS Quality Value: Date of Measurement: 08/12/2012

Reason for Abandonment: ☐ Dry ☐ Production Sub-economic ☐ Mechanical Problems☒ Other Orphaned WellCasing to be pulled: ☐ Yes ☒ No Estimated Depth:Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
J SAND	7497	7528			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/2	8+5/8	UNK	24	0	210	175	210	0	VISU
1ST	7+7/8	5+1/2	UNK	17	6695	7630	150	7630	6695	CALC

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7422 with 3 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 6500 ft. with 45 sacks. Leave at least 100 ft. in casing 6410 CICR Depth

Perforate and squeeze at 2480 ft. with 50 sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at 1192 ft. with 90 sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 200 sacks half in. half out surface casing from 550 ft. to 0 ft. Plug Tagged: ☒

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Surface Plug Setting Date: _____ Cut and Cap Date: _____ Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____

*Wireline Contractor: _____

*Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

CBL Required. Plugging procedure may be modified based on CBL cement coverage findings.

The following are descriptions perforate and squeeze plugs with Tag requirements.

Plug #2 - Perf at 6500' and 6400', set CICR at 6410' and pump 35 sx through CICR. Leave 10 sx on top of CICR.

Plug #3 - Perf at 2480' and pump 40 sx through perms. Leave 10 sx inside. Tag above 2380' is required.

Plug #4 - Perf at 1192' and pump 50 sx through perms. Leave 40 sx inside. Tag above 873' is required.

Plug #5/Surface - Perf at 550' and pump 120 sx through perms. Leave 80 sx inside. Cement to surface.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: Cal St. John

Title: OWP Engineering Tech

Date: _____

Email: cal.stjohn@state.co.us

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

Condition of Approval

COA Type**Description**

0 COA	

Attachment List

Att Doc Num**Name**

402909876	WELLBORE DIAGRAM
-----------	------------------

Total Attach: 1 Files

General Comments

User Group**Comment****Comment Date**

		Stamp Upon Approval
--	--	------------------------

Total: 0 comment(s)