

FORM  
6Rev  
11/20

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

402910964

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required,

Name: Peterson, Tom

Tel: (970) 370-1281

COGCC contact:

Email: tom.peterson@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-15975-00

Well Name: STROH

Well Number: 24-22

Location: QtrQtr: NWNW Section: 24 Township: 4N Range: 67W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 66715

Field Name: WATTENBERG

Field Number: 90750

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.302500

Longitude: -104.846944

GPS Data: GPS Quality Value: 2.4 Type of GPS Quality Value: Date of Measurement: 06/23/2010

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes ☐ No Estimated Depth: 2500Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	6986	7320			

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	343	200	370	0	VISU
1ST	7+7/8	4+1/2	J55	12.6	0	7459	150	7459	6720	CBL
S.C. 1.1						5600	460	5600	4320	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6936 with 2 sacks cmt on top. CIBP #2: Depth 4674 with 2 sacks cmt on top.  
 CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set <u>100</u> sks cmt from <u>2550</u> ft. to <u>2300</u> ft.	Plug Type: <u>STUB PLUG</u>	Plug Tagged: <input type="checkbox"/>
Set <u>100</u> sks cmt from <u>1440</u> ft. to <u>1240</u> ft.	Plug Type: <u>OPEN HOLE</u>	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 315 sacks half in. half out surface casing from 570 ft. to 0 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_  
 Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

#### Technical Detail/Comments:

Stroh 24-22 (05-123-15975) / Plugging Procedure (Intent)  
 Producing Formations: Niobrara/Codell: 6986'-7320'

Upper Pierre Aquifer: 370'-1340'

Deepest Water Well: 45' Base of Fox Hills: 195'  
 TD: 7500' PBTD: 7417' (4/12/2010)  
 Surface Casing: 8 5/8" 24# @ 343' w/ 200 sxs cmt  
 Production Casing: 4 1/2" 12.6# @ 7459' w/ 150 sxs (TOC @ 6720' – CBL)  
 Annular Fill @ 5600' w/ 460 sxs (TOC @ 4320' – CBL)

Tubing: 2 3/8" 4.7# set @ 7297.03' (10/9/2015)

#### Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6936'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Nio perfs @ 6986')
4. TIH with CIBP. Set BP at 4674'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Shannon @ 4724')
5. TIH with casing cutter. Cut 4 1/2" casing @ 2500'. Pull cut casing.
6. TIH with tubing to 2550'. RU cementing company. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Stub Plug Coverage from 2550'-2300')
7. Wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or fluid migration, contact engineering before continuing operations.
8. TIH with tubing to 1440'. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Pierre Coverage from 1440'-1240')
9. Pick up with tubing to 570'. Mix and pump 315 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
10. Well casing cut and capped per COGCC guidelines at a depth as not to interfere with soil cultivation.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Valerie Danson  
Title: Reg Analyst Date: \_\_\_\_\_ Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: \_\_\_\_\_ Expiration Date: \_\_\_\_\_

**COA Type** **Description**

--	--

### Attachment List

**Att Doc Num** **Name**

402910982	WELLBORE DIAGRAM
402910983	WELLBORE DIAGRAM

Total Attach: 2 Files

### General Comments

**User Group** **Comment** **Comment Date**

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)