

Operations Summary Haun-Delaney #1

7/14/2021

0630-0730: AOL. SAFETY MEETING & JSA. MIRU RIG. FLAG DOGS & GUY WIRES.

0730-0900: 0 PSI ON WELL. OPEN WELL. HANG OFF RODS. REMOVE PUMPING UNIT. UN-SEAT PUMP. L/D 109- 3/4" X 25' RODS & PUMP. MOVE TRAILER OUT OF THE WAY.

0900-1100: N/D WELL HEAD. REMOVE THE LARKIN SLIPS. STRIP ON 7 5/8" X-OVER SPOOL FOR THE LARKIN HEAD. STRIP ON & N/U BOP'S. R/U FLOOR & EQUIPMENT.

1100-1200: TOO H W/ 85 JTS OF 2 3/8" TBG, PSN, 4' PERF SUB, 1 JT OF 2 3/8" TBG & BULL PLUG.

1200-1530: MIRU WIRELINE GROUP. RIH W/ 3.75" G.R. TAGGED PBD @ 2,778'. POOH W/ G.R. RIH W/ 4 1/2" CICR. SET @ 2,688'. POOH W/ SETTING TOOL. FILL CSG W/ 55 BBLs OF FRESH WTR. TEST TO 1K (GOOD). WAITED FOR GAS BUBBLES TO CEASE FROM THE WELL BORE. RIH W/ CBL TOOL. LOG FROM CICR TO SURFACE. NO CMT BEHIND PIPE. R/D WIRELINE.

1530-1730: M/U STINGER & RIH W/ 83 JTS OF 2 3/8" TBG. P/U 10' PUP JT. STING INTO CICR. STING OUT. SWIFN. RESUME OP'S IN THE AM.

7/15/2021

0630-0800: AOL. SAFETY MEETING & JSA. 0 PSI ON WELL. OPEN WELL. STING INTO CICR @ 2,688'. SQUEEZE 15 SXS OF 15.8# CMT BELOW. STING OUT. SPOT 5 SXS OF 15.8# CMT ON TOP. DISPLACED W/ 9.4 BBLs OF FRESH WTR. L/D 37 JTS OF 2 3/8" TBG. POOH W/ 46 JTS OF 2 3/8" TBG & STINGER.

0800-0900: MIRU WIRELINE. RIH W/ 3 1/8" PERG GUN (4SHOT). PERF CSG @ 1,537'. POOH W/ GUN. RIH W/ 4 1/2" CICR. SET @ 1,487'. POOH W/ SETTING TOOL.

0900-1000: M/U STINGER & RIH W/ 46 JTS OF 2 3/8" TBG. STING INTO CICR. SQUEEZE 20 SXS OF 15.8# CMT BELOW. STING OUT. SPOT 5 SXS OF 15.8# CMT ON TOP. DISPLACED W/ 4.8 BBLs OF WTR. L/D 13 JTS OF 2 3/8" TBG. POOH W/ 33 JTS OF 2 3/8" TBG & STINGER. TOP CSG OFF W/ WTR.

1000-1100: RIH W/ 3 1/8" PERF GUN. PERF CSG @ 1,132'. POOH W/ GUN. RIH W/ 4 1/2" CICR. SET @ 1,082'. POOH W/ SETTING TOOL.

1100-1200: M/U STINGER & RIH W/ 33 JTS OF 2 3/8" TBG. STING INTO CICR. SQUEEZE 17 SXS OF 15.8# CMT BELOW. STING OUT. SPOT 5 SXS OF 15.8# CMT ON TOP. DISPLACED W/ 2.9 BBLs OF WTR. L/D 11 JTS OF 2 3/8" TBG. POOH W/ 22 JTS OF 2 3/8" TBG & STINGER.

1200-1230: RIH W/ PERF GUN. PERF CSG @ 774' (CSG COLLAR @ 780'). POOH W/ GUN. RIH W/ 4 1/2" CICR. SET @ 729'. POOH W/ SETTING TOOL.

1230-1300: M/U STINGER & RIH W/ 22 JTS OF 2 3/8" TBG. STING INTO CICR. SQUEEZE 17 SXS OF 15.8# CMT BELOW. STING OUT. SPOT 5 SXS OF 15.8# ON TOP. DISPLACED W/ 1.8 BBLs OF WTR. L/D 22 JTS OF 2 3/8" TBG & STINGER.

1300-1330: RIH W/ PERF GUN. PERF CSG @ 245' (CSG COLLAR @ 252'). POOH W/ GUN. BROKE CIRC W/ WTR (NO NEED FOR CICR). R/D WIRELINE.

1330-1630: CHANGE OVER HANDLING EQUIPMENT FOR RODS. R/D FLOOR & EQUIPMENT. N/D BOP'S. N/U WELL HEAD. ROLE AROUND 67 SXS OF 15.8# CMT DOWN THE 4 1/2" CSG & OUT THE SURFACE CSG. WASH UP. SECURE WELL. R/D RIG GET EQUIPMENT READY TO MOB TO NEXT WELL. SECURE LOCATION FOR NIGHT. JOB COMPLETE. FINAL REPORT.

7/20/2021

Cut, cap, and bury per COGCC rules and regulations.