

Document Number:  
402935291

Date Received:

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000 Fax: \_\_\_\_\_

City: DENVER State: CO Zip: 80203 Email: valerie.danson@pdce.com

**For "Intent" 24 hour notice required,** Name: Serna, Abe Tel: (720) 661-7317

**COGCC contact:** Email: abe.serna@state.co.us

Type of Well Abandonment Report:  Notice of Intent to Abandon  Subsequent Report of Abandonment

API Number 05-123-22035-00

Well Name: CLEMONS Well Number: 32-3

Location: QtrQtr: SWNE Section: 3 Township: 5N Range: 64W Meridian: 6

County: WELD Federal, Indian or State Lease Number: \_\_\_\_\_

Field Name: WATTENBERG Field Number: 90750

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.429580 Longitude: -104.533780

GPS Data: GPS Quality Value: 2.1 Type of GPS Quality Value: \_\_\_\_\_ Date of Measurement: 05/17/2008

Reason for Abandonment:  Dry  Production Sub-economic  Mechanical Problems

Other \_\_\_\_\_

Casing to be pulled:  Yes  No Estimated Depth: 2500

Fish in Hole:  Yes  No If yes, explain details below

Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below

Details: \_\_\_\_\_

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6797	6805	01/25/2021	B PLUG CEMENT TOP	6768

Total: 1 zone(s)

**Casing History**

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	563	615	563	0	VISU
1ST	7+7/8	4+1/2	J55	10.5	0	6987	155	6987	6105	CBL
S.C. 1.1						6105	290	6105	2810	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6450 with 2 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 100 sks cmt from 2550 ft. to 2300 ft. Plug Type: STUB PLUG Plug Tagged:   
Set 100 sks cmt from 1740 ft. to 1540 ft. Plug Type: OPEN HOLE Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
(Cast Iron Cement Retainer Depth)  
Set 357 sacks half in. half out surface casing from 763 ft. to 0 ft. Plug Tagged:   
Set \_\_\_\_\_ sacks at surface  
Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

## Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_  
Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_  
\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_  
Type of Cement and Additives Used: \_\_\_\_\_  
Flowline/Pipeline has been abandoned per Rule 1105  Yes  No

### Technical Detail/Comments:

Clemons 32-3 (05-123-22035) / Plugging Procedure (Intent)  
Abandoned/TA'd Formation: Codell: 6797'-6805'

Upper Pierre Aquifer: 320' – 1640'

Deepest Water Well: 505'

TD: 6998' PBD: 7367' (8/7/2008)

Surface Casing: 8 5/8" 24# @ 563' w/ 615 sxs cmt

Production Casing: 4 1/2" 10.5# @ 6987' w/ 155 sxs (TOC @ 6105' – CBL)

S.C.C.1. @ 6105' w/ 290 sxs (TOC @ 2810' – CBL)

Existing CIBP @ 6768' w/ 2 sxs cmt (1/25/2021)

Tubing: 2 3/8" 4.7# set @ 6134' (1/25/2021)

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company. TIH and tag dump bail of Existing CIBP @ 6768'.
3. TIH with CIBP. Set BP at 6450'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Niobrara @ 6500')
4. TIH with casing cutter. Cut 4 1/2" casing @ 2500'. Pull cut casing.
5. TIH with tubing to 2550'. RU cementing company. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Stub Plug from 2550'-2300')
6. Wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or fluid migration, contact engineering before continuing operations.
7. TIH with tubing to 1740'. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Pierre Coverage from 1740'-1540')
8. Pick up with tubing to 763'. Mix and pump 357 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
9. Well casing cut and capped per COGCC guidelines at a depth as not to interfere with soil cultivation.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Valerie Danson  
Title: Reg Analyst Date: \_\_\_\_\_ Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_ Expiration Date: \_\_\_\_\_

<u>COA Type</u>	<u>Description</u>

**Attachment List**

<u>Att Doc Num</u>	<u>Name</u>
402935308	WELLBORE DIAGRAM
402935309	WELLBORE DIAGRAM

Total Attach: 2 Files

**General Comments**

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)