

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Document Number:
402867628

Date Received:
11/10/2021

FIR RESOLUTION FORM

Overall Status: CAC

CA Summary:

1 of 1 CAs from the FIR responded to on this Form

1 CA Completed
0 Factual Review Request

OPERATOR INFORMATION

OGCC Operator Number: 10456

Name of Operator: CAERUS PICEANCE LLC

Address: 1001 17TH STREET #1600

City: DENVER State: CO Zip: 80202

Contact Name and Telephone:

Name: _____

Phone: () _____ Fax: () _____

Email: _____

Additional Operator Contact:

Contact Name

Phone

Email

Romana Cowden

720-951-5895

cogcc.inspections@caerusoilandgas.com

COGCC INSPECTION SUMMARY:

FIR Document Number: 696203307

Inspection Date: 10/25/2021

FIR Submit Date: 10/27/2021

FIR Status: _____

Inspected Operator Information:

Company Name: CAERUS PICEANCE LLC

Company Number: 10456

Address: 1001 17TH STREET #1600

City: DENVER State: CO Zip: 80202

LOCATION - Location ID: 311604

Location Name: GL-67S93W Number: 18SWSE County: _____

Qtrqr: SWSE Sec: 18 Twp: 7S Range: 93W Meridian: 6

Latitude: 39.439500 Longitude: -107.812230

FACILITY - API Number: 05-045- -00 Facility ID: 311604

Facility Name: GL-67S93W Number: 18SWSE

Qtrqr: SWSE Sec: 18 Twp: 7S Range: 93W Meridian: 6

Latitude: 39.439500 Longitude: -107.812230

CORRECTIVE ACTIONS:

1 ☒ CA# 157196

Corrective Action: Comply with Rule 1002.f

Date: 10/25/2021

Response: CA COMPLETED

Date of Completion: 11/09/2021

Operator

Comment:

TEP had previously added this road to access their location. They added road base to expand the size of the road so that two trucks can pass with no issues; they have also ordered signs to keep on the road, which will be installed as soon as they arrive.

COGCC Decision: **Not Approved**

Inspection observed that control measures to stabilize the production areas of the Location, and to mitigate

COGCC Representative:	<p>tracking and offsite sediment transport from the Location have not been maintained in proper functioning condition, and are in disrepair. Inspection required Operator to comply with Rule 1002.f.</p> <p>Operator states CA Completed on 11/9/2021. Operator has provided no documentation attached to this resolution to show work has been conducted per corrective action(s). Additionally, follow-up inspection on 12/7/2021 observed that the Location remains out of compliance with Rule 1002.f</p> <p>Caerus remains responsible for ensuring that control measures are implemented and maintained in proper functioning condition to stabilize the Location, and to minimize offsite sediment.</p>
-----------------------	---

OPERATOR COMMENT AND SUBMITTAL	
Comment:	TEP had previously added this road to access their location. They added road base to expand the size of the road so that two trucks can pass with no issues; they have also ordered signs to keep on the road, which will be installed as soon as they arrive.
<p>I hereby certify that the statements made in this form are, to the best of my knowledge, true, correct, and complete.</p> <p>Print Name: <u>Romana Cowden</u> Signed: _____</p> <p>Title: <u>EHS</u> Date: <u>11/10/2021 1:08:16 PM</u></p>	

ATTACHMENT LIST

View Attachments in Imaged Documents on COGCC website (<http://ogccweblink.state.co.us/>) - Search by Document Number.

<u>Document Number</u>	<u>Description</u>
402867628	FIR RESOLUTION SUBMITTED

Total Attach: 1 Files