

FORM
6Rev
11/20

State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

402943628

Date Received:

02/07/2022

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: Grace Howley

Name of Operator: NOBLE ENERGY INC

Phone: (281) 382-8234

Address: 1001 NOBLE ENERGY WAY

Fax:

City: HOUSTON State: TX Zip: 77070

Email: grace.howley@chevron.com

For "Intent" 24 hour notice required,

Name: Serna, Abe

Tel: (720) 661-7317

COGCC contact:

Email: abe.serna@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-14812-00

Well Name: FRED ARENS

Well Number: 6

Location: QtrQtr: NESW Section: 12 Township: 4N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 68606

Field Name: WATTENBERG

Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.325513

Longitude: -104.613832

GPS Data: GPS Quality Value: 1.8 Type of GPS Quality Value: PDOP Date of Measurement: 07/26/2006

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes ☒ No Estimated Depth:Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7075	7091			
NIOBRARA	6776	6960			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	506	250	506	0	VISU
1ST	7+7/8	4+1/2	M-75	11.6	0	7207	260	7207	6016	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6726 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set <u>5</u> sks cmt from <u>4098</u> ft. to <u>4048</u> ft.	Plug Type: <u>CASING</u>	Plug Tagged: <input type="checkbox"/>
Set <u>35</u> sks cmt from <u>2400</u> ft. to <u>2000</u> ft.	Plug Type: <u>CASING</u>	Plug Tagged: <input type="checkbox"/>
Set <u>55</u> sks cmt from <u>706</u> ft. to <u>0</u> ft.	Plug Type: <u>CASING</u>	Plug Tagged: <input checked="" type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>

Perforate and squeeze at 4148 ft. with 35 sacks. Leave at least 100 ft. in casing 4098 CICR Depth
Perforate and squeeze at 2500 ft. with 155 sacks. Leave at least 100 ft. in casing 2400 CICR Depth
Perforate and squeeze at 706 ft. with 170 sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Surface Plug Setting Date: _____ Cut and Cap Date: _____ Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____

*Wireline Contractor: _____

*Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

This well is part of the AOC (Order 1V-668) Alt MIT program.
3rd party wildlife surveys will be conducted on this well prior to rigging up for P&A activities.
Notification will be given to any adjacent building unit occupants within a 1000 feet of the wellhead of planned P&A start date.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Stephanie Dionne

Title: Operations Tech Date: 2/7/2022 Email: stephanie.dionne@chevron.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: McFarland, Nick Date: 2/15/2022

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: 8/14/2022

Condition of Approval

COA Type

Description

	<p>1) Provide electronic Form 42 Notice of MIRU 2 business days ahead of operations and electronic Form 42 Notice of Plugging Operations 48 hours prior to mobilizing for plugging operations.</p> <p>2) After placing the shallowest hydrocarbon isolating plug (4148'), operator must wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or of fluid migration, contact COGCC engineering before continuing operations.</p> <p>3) Prior to placing the 706' plug: verify that all fluid migration (liquid and gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>4) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 456' or shallower and provide 10 sx plug at the surface.</p> <p>5) Leave at least 100' of cement in the wellbore for each plug.</p> <p>6) Properly abandon flowlines as per Rule 1105. Pursuant to Rule 911.a. Closure of Oil and Gas Facilities, Operator will submit Site Investigation and Remediation Workplans via Form 27 for COGCC prior approval before cutting and capping the plugged well, conducting flowline abandonment, and removing production equipment. Pursuant to Rule 1105.f. Abandonment Verification, within 90 days of an operator completing abandonment requirements for a flowline or crude oil transfer line, an operator must submit a Field Operations Notice, Form 42-Abandonment of Flowlines for on-location flowlines, or a Flowline Report, Form 44, for off-location flowlines or crude oil transfer lines.</p> <p>7) With the Form 6 SRA operator must provide written documentation which positively affirms each COA listed above has been addressed.</p>
	<p>Prior to starting plugging operations a bradenhead test shall be performed if there has not been a reported bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the COGCC within three (3) months of collecting the samples.</p> <p>If there is a need for sampling, contact COGCC engineering for verification of plugging procedure.</p>
	<p>Operator will implement measures to capture, combust, or control emissions to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public health, welfare and the environment.</p>

3 COAs

Attachment List

Att Doc Num

Name

402943628	FORM 6 INTENT SUBMITTED
402949462	WELLBORE DIAGRAM
402949463	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Engineer	Most recent bradenhead test 6/29/21 - 0 psi. SI since December 2016 - Noble AOC. SB5 Base of Fox Hills Aquifer: 382' Deepest water well within 1 mile: 380' # of wells: 39 Production within one mile: JSND, CODL, NBRR, SUSX	02/15/2022
Permit	-Confirmed as-drilled well location. -No other forms in process. -Confirmed productive interval docnum: 634436. -Reviewed WBD. -Production reporting up-to-date. -Pass.	02/07/2022

Total: 2 comment(s)