

FORM  
INSPRev  
X/20

## State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

03/16/2022

Submitted Date:

03/16/2022

Document Number:

693506728

### FIELD INSPECTION FORM

Loc ID \_\_\_\_\_ Inspector Name: \_\_\_\_\_ On-Site Inspection   
456747 \_\_\_\_\_ Silver, Randy \_\_\_\_\_ 2A Doc Num: \_\_\_\_\_

**Operator Information:**

OGCC Operator Number: 10459  
Name of Operator: EXTRACTION OIL & GAS INC  
Address: 370 17TH STREET SUITE 5200  
City: DENVER State: CO Zip: 80202

**Status Summary:**

- THIS IS A FOLLOW UP INSPECTION  
 FOLLOW UP INSPECTION REQUIRED  
 NO FOLLOW UP INSPECTION REQUIRED

**Findings:**

3 Number of Comments  
0 Number of Corrective Actions  
 Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM  
PREVIOUS INSPECTIONS THAT HAVE NOT  
BEEN ADDRESSED ARE STILL APPLICABLE**

**Contact Information:**

Contact Name	Phone	Email	Comment
Adamczyk, Megan		megan.adamczyk@state.co.us	
Bonanza, Creston	Extraction, Axis, Highpoint	Inspections@civiresources.com	All Inspections.

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
456745	WELL	DG	09/21/2019	OW	014-20768	INTERCHANGE A S22-30-7C	DG

**General Comment:**

**Inspected Facilities**

Facility ID: 456745 Type: WELL API Number: 014-20768 Status: DG Insp. Status: DG

**Complaint**

Comment: Inspection in response to complaint.  
 Field Inspector Assigned: Randy Silver  
 Complaint Received  
 Date: 3-12-2022  
 Complaint Contacted: Yes via phone left voice mail.  
 Date: 3-16-2022 Time: 8:36AM  
 Location ID #456747  
 Location name: Interchange A pad  
 Inspection Document # 693506706  
 Complaint inspection document #693506728  
 Complaint Document form 18 # 402982790  
 Nature of Complaint: Fire  
 Field Inspector Actions:  
 On 3-14-2021, I Randy Silver area field inspector was assigned a complaint received by COGCC staff in reference to Fire. The complainant Barb Binder 15583 Quivas ST Broomfield CO stated the issues were occurring at the Interchange A pad.  
 On 3-16-2022, I attempted to make contact with the complainant who indicated that on 3-12-2022 complainant stated a plume of black smoke coming from the Interchange a and b pads.  
 I performed a complete site inspection of the oil and gas location and associated wells in the area. At time of inspection, I performed walk around with rig supervisor Danny Herrera  
 At time of inspection, I spoke with Danny Herrera drilling supervisor, he stated at time of complaint they were drilling the curve of the well bore they swapped the flow to the Gas buster. Return line to the gas buster was apparently plugged which in turn filled gas buster sending small amount of fluid to the combustor. Fluid in combustor did ignite. Initial response of fire was handle by onsite personal. North Metro Fire District did arrive on site who used approx... 5 gallons of foam to extinguish remaining fire inside of combustor.  
 Gas buster has since been revamped to assure issue has been addressed.  
 Weather conditions: Clear and sunny  
 No violation of COGCC rules were observed at the time of the inspection.  
 All information has been reviewed and site inspection information has been submitted to the COGCC for further review.

Corrective Action:

Date:

**COGCC Comments**

Comment	User	Date
See inspecton Doc # 693506706 for full inspection.	silverr	03/16/2022