

**FORM
INSP**Rev
X/20

State of Colorado

Oil and Gas Conservation Commission

 1120 Lincoln Street, Suite 801, Denver, Colorado 80203
 Phone: (303) 894-2100 Fax: (303) 894-2109


Inspection Date:

03/16/2022

Submitted Date:

03/16/2022

Document Number:

693506729

FIELD INSPECTION FORM
 Loc ID 456747 Inspector Name: Silver, Randy On-Site Inspection ☐ 2A Doc Num:
Operator Information:

OGCC Operator Number: 10459

Name of Operator: EXTRACTION OIL & GAS INC

Address: 370 17TH STREET SUITE 5200

City: DENVER State: CO Zip: 80202

Status Summary:

- ☐ THIS IS A FOLLOW UP INSPECTION
- ☐ FOLLOW UP INSPECTION REQUIRED
- ☒ NO FOLLOW UP INSPECTION REQUIRED

Findings:

3 Number of Comments

0 Number of Corrective Actions

☐ Corrective Action Response Requested
**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE**
Contact Information:

Contact Name	Phone	Email	Comment
Bonanza, Creston	Extraction, Axis, Highpoint	Inspections@civiresources.com	All Inspections.
Adamczyk, Megan		megan.adamczyk@state.co.us	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
456745	WELL	DG	09/21/2019	OW	014-20768	INTERCHANGE A S22-30-7C	DG

General Comment:

Inspected Facilities

Facility ID: 456745 Type: WELL API Number: 014-20768 Status: DG Insp. Status: DG

Complaint

Comment: Inspection in response to complaint.
 Field Inspector Assigned: Randy Silver
 Complaint Received
 Date: 3-12-2022
 Complaint Contacted: No contact information provided
 Date: 3-16-2022 Time: 8:15AM
 Location ID #456747
 Location name: Interchange A pad
 Inspection Document # 693506706
 Complaint inspection document #693506729
 Complaint Document form 18 # 402983010
 Nature of Complaint: Fire
 Field Inspector Actions:
 On 3-14-2021, I Randy Silver area field inspector was assigned a complaint received by COGCC staff in reference to Fire. The complainant in Broomfield CO stated the issues were occurring at the Interchange A pad.
 On 3-16-2022, I attempted to make contact with the complainant who indicated that on 3-12-2022 complainant stated a fire coming from the Interchange a and b pads.
 I performed a complete site inspection of the oil and gas location and associated wells in the area. At time of inspection, I performed walk around with rig supervisor Danny Herrera
 At time of inspection, I spoke with Danny Herrera drilling supervisor, he stated at time of complaint they were drilling the curve of the well bore they swapped the flow to the Gas buster. Return line to the gas buster was apparently plugged which in turn filled gas buster sending small amount of fluid to the combustor. Fluid in combustor did ignite. Initial response of fire was handle by onsite personal. North Metro Fire District did arrive on site who used approx... 5 gallons of foam to extinguish remaining fire inside of combustor.
 Gas buster has since been revamped to assure issue has been addressed.
 Weather conditions: Clear and sunny
 No violation of COGCC rules were observed at the time of the inspection.
 All information has been reviewed and site inspection information has been submitted to the COGCC for further review.

Corrective Action:

Date:

COGCC Comments

Comment	User	Date
See inspection doc # 693506706 for full inspection.	silverr	03/16/2022