

**FORM  
INSP**Rev  
X/20**State of Colorado  
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

03/16/2022

Submitted Date:

03/17/2022

Document Number:

688312370**FIELD INSPECTION FORM**Loc ID 317307 Inspector Name: Sherman, Susan On-Site Inspection ☐ 2A Doc Num: \_\_\_\_\_**Operator Information:**OGCC Operator Number: 20275Name of Operator: CORAL PRODUCTION CORPAddress: 1600 STOUT ST STE 1500City: DENVER State: CO Zip: 80202**Status Summary:**

- ☐ THIS IS A FOLLOW UP INSPECTION
- ☐ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

**Findings:**3 Number of Comments0 Number of Corrective Actions☐ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM  
PREVIOUS INSPECTIONS THAT HAVE NOT  
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Wieger, Jim	(303) 623-3573	JIMWIEGER@QWESTOFFICE.NET	
Chonka, Jim	(303) 623-3573	jpchonka@netscape.net	
Yetter, Ron		yetter.well@hotmail.com	

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
237991	WELL	SI	07/01/2019	OW	121-10494	LINDA 1	PA

**General Comment:**PA Inspection

**Inspected Facilities**Facility ID: 237991 Type: WELL API Number: 121-10494 Status: SI Insp. Status: PA**Cement**Cement ContractorContractor Name: Yetter

Contractor Phone: \_\_\_\_\_

Surface Casing

Cement Volume (sx): \_\_\_\_\_

Circulate to Surface: \_\_\_\_\_

Cement Fall Back: \_\_\_\_\_

Top Job, 1" Volume: \_\_\_\_\_

Intermediate Casing

Cement Volume (sxs): \_\_\_\_\_

Good Return During Job: \_\_\_\_\_

Production Casing

Cement Volume (sx): \_\_\_\_\_

Good Return During Job: \_\_\_\_\_

Plugging Operations

Depth Plugs(feet range): \_\_\_\_\_

Cement Volume (sx): \_\_\_\_\_

Good Return During Job: \_\_\_\_\_

Cement Type: \_\_\_\_\_

Comment: Bradenhead was dead.

Bottom/production CIBP being set on tubing due to cement amount needed per Form 6.  
On 3/16/2022 COGCC Eng agreed per text that only 4 sxs was needed on top of CIBP  
and so cementing will be moved forward in time because 4 sxs can be placed with  
wireline at time of perforating.

Corrective Action: \_\_\_\_\_

Date: \_\_\_\_\_

**Workover**Comment: Yetter Rig 9

Corrective Action: \_\_\_\_\_

Date: \_\_\_\_\_

**Attached Documents**You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
688312375	Coral Linda 1 PA	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5697349">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5697349</a>