

FORM
6Rev
11/20

State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

402962344

Date Received:

02/22/2022

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: Renee Call

Name of Operator: NOBLE ENERGY INC

Phone: (303) 909-6814

Address: 2001 16TH STREET SUITE 900

Fax:

City: DENVER State: CO Zip: 80202

Email: renee.call@chevron.com

For "Intent" 24 hour notice required,

Name: Burns, Adam

Tel: (970) 218-4885

COGCC contact:

Email: adam.m.burns@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-22184-00

Well Name: ABBEY D

Well Number: 1-6

Location: QtrQtr: SENW Section: 1 Township: 3N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.256000

Longitude: -104.501620

GPS Data: GPS Quality Value: 1.8 Type of GPS Quality Value: PDOP Date of Measurement: 11/14/2006

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes ☐ No Estimated Depth: 838Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6847	6857			
NIOBRARA	6584	6724			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	NA	24	0	638	450	638	0	VISU
1ST	7+7/8	4+1/2	M-80	11.6	0	6969	220	6969	3318	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6550 with 2 sacks cmt on top. CIBP #2: Depth 4170 with 2 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 35 sks cmt from 2400 ft. to 2000 ft. Plug Type: CASING Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 2500 ft. with 155 sacks. Leave at least 100 ft. in casing 2400 CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 265 sacks half in. half out surface casing from 838 ft. to 0 ft. Plug Tagged: ☒

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Surface Plug Setting Date: _____ Cut and Cap Date: _____ Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____

*Wireline Contractor: _____

*Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

This well is part of the AOC (Order 1V-668) Alt MIT program.
3rd party wildlife surveys will be conducted on this well prior to rigging up for P&A activities.
Notification will be given to any adjacent building unit occupants within a 1000 feet of the wellhead of planned P&A start date.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Stephanie Dionne

Title: Operations Tech Date: 2/22/2022 Email: stephanie.dionne@chevron.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Haverkamp, Curtis Date: 3/21/2022

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: 9/20/2022

Condition of Approval

COA Type

Description

	Prior to setting Sussex CIBP, verify existing cement coverage by CBL - submit to COGCC for verification of plugging orders prior to continuing plugging operations.
	<p>1) Provide electronic Form 42 Notice of MIRU 2 business days ahead of operations and electronic Form 42 Notice of Plugging Operations 48 hours prior to mobilizing for plugging operations.</p> <p>2) After placing the shallowest hydrocarbon isolating plug, operator must wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or of fluid migration, contact COGCC engineering before continuing operations.</p> <p>3) Prior to placing the 838' plug: verify that all fluid migration (liquid and gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>4) After isolation has been verified, pump plug and displace. Circulate cement to surface if production casing is not pulled.</p> <p>5) Leave at least 100' of cement in the wellbore for each plug.</p> <p>6) Properly abandon flowlines as per Rule 1105. Pursuant to Rule 911.a. Closure of Oil and Gas Facilities, Operator will submit Site Investigation and Remediation Workplans via Form 27 for COGCC prior approval before cutting and capping the plugged well, conducting flowline abandonment, and removing production equipment. Pursuant to Rule 1105.f. Abandonment Verification, within 90 days of an operator completing abandonment requirements for a flowline or crude oil transfer line, an operator must submit a Field Operations Notice, Form 42-Abandonment of Flowlines for on-location flowlines, or a Flowline Report, Form 44, for off-location flowlines or crude oil transfer lines.</p> <p>7) With the Form 6 SRA operator must provide written documentation which positively affirms each COA listed above has been addressed.</p>
	<p>Prior to starting plugging operations a bradenhead test shall be performed if there has not been a reported bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the COGCC within three (3) months of collecting the samples.</p> <p>If there is a need for sampling, contact COGCC engineering for verification of plugging procedure.</p>
	Operator will implement measures to capture, combust, or control emissions to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public health, welfare and the environment.

4 COAs

Attachment List

Att Doc Num

Name

402962344	FORM 6 INTENT SUBMITTED
402962373	WELLBORE DIAGRAM
402962375	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Engineer	Emailed operator regarding placement of CIBPs. Adjusted Nio to 6550' as per email. Placed COA for cement bond log prior to Sussex plug.	03/21/2022
Engineer	DWR base of Fox Hills: 491' Deepest water well within 1 mile: 42'	03/21/2022
OGLA	This oil and gas location is within CPW mapped Pronghorn Winter Concentration Area High Priority Habitat. CPW recommends that plugging and abandonment (PA) activities should not take place from January 1 to April 30.	03/21/2022
Permit	Submit Operator's Monthly Production Reports (Form 7) required for compliance with Rule 413 within 30 days. Missing 11/2009-1/2014, 3/2014-10/2014 for NB-CD. Was falsely reported as just Codell.	02/23/2022
Permit	Confirmed as-drilled well location. No other forms in process. Production reporting delinquent. Confirmed productive intervals docnum: 1948592. Reviewed WBDs. Pass.	02/23/2022

Total: 5 comment(s)