

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

03/28/2022

Submitted Date:

03/29/2022

Document Number:

696203532**FIELD INSPECTION FORM**Loc ID 453726 Inspector Name: Trujillo, Aaron On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**OGCC Operator Number: 10163Name of Operator: NONSUCH NATURAL GAS INCAddress: P O BOX 110066City: NAPLES State: FL Zip: 34108**Status Summary:**

- ☒ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:5 Number of Comments4 Number of Corrective Actions☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

| Contact Name | Phone | Email | Comment |
|--------------|--------------|---------------------------|---------|
| Lee, David | 239-289-9046 | dlee@nng.us.com | |
| | | denise.arthur@state.co.us | |

Inspected Facilities:

| Facility ID | Type | Status | Status Date | Well Class | API Num | Facility Name | Insp Status |
|-------------|--------------|--------|-------------|------------|---------|--------------------------|-------------|
| 453727 | TANK BATTERY | AC | 01/12/2018 | | - | CSOC 697-14 Tank Battery | RI |

General Comment:

On 03/28/2022, Reclamation Specialist Trujillo inspected Nonsuch Natural Gas Inc's CSOC TB Location in Garfield County, Colorado.

This inspection is a followup to:

#696201797 dated 9/16/2020;

#696201822 dated 9/24/2020;

#696201988 dated 11/02/2020;

#696202916 dated 7/12/2021;

#696203087 dated 8/23/2021;

and #696203324 dated 11/1/2021 to document compliance with the following corrective actions:

-Unused or unneeded equipment on the Location

-Good Housekeeping

-Stormwater

-Wildlife Protection measures

It was observed in this inspection that the Location remains out of compliance with COGCC Rules and corrective actions.

Refer to the "Good Housekeeping", "Equipment", "Reclamation", "Stormwater" sections of this inspection report for additional details.

Refer to the photo-documentation of the observed compliance issues attached to this report.

Any corrective action(s) from previous inspections that have not been addressed are still applicable.

A follow up inspection on this site will be conducted to ensure the compliance issues have been corrected to comply with COGCC rules.

LocationOverall Good: ☐

Emergency Contact Number:

Comment: Corrective Action: Date: **Good Housekeeping:**

| | | | |
|--------------------|---|-------|------------|
| Type | UNUSED EQUIPMENT | | |
| Comment: | <p>Previous inspections documented equipment on the Location (200 bbl tank, 500 gallon methanol tank, separator) that did not appear to be active, or necessary for production activities on the Location.</p> <p>Operator was required to submit a Form 4 sundry with records identifying equipment's current status and use for production on the Location by 10/2/2020.</p> <p>Inspection #696203087 noted that Operator failed to submit the documentation and required Operator to comply with Rule 606.a and remove unused equipment from the Location.</p> <p>It was observed in this inspection that the equipment remains on the Location; no documentation has been submitted by Operator identifying current status/use on Location.</p> | | |
| Corrective Action: | Comply with Rule 606 and remove equipment not necessary for use on the Location. | Date: | 10/02/2020 |
| Type | UNUSED EQUIPMENT | | |
| Comment: | <p>Previous inspections documented unused pipe equipment stored behind the methanol tank. Inspections required Operator to comply with Rule 606 and remove unused equipment</p> <p>It was observed in this inspection that the various unused pipe and honeypot remains improperly stored on the Location, behind the methanol tank.</p> <p>This corrective action has not been addressed and remains applicable.</p> | | |
| Corrective Action: | Comply with Rule 606 and remove unused equipment. | Date: | 11/10/2020 |

Overall Good: ☐**Spills:**

| | | | | |
|------|------|--------|--|--|
| Type | Area | Volume | | |
|------|------|--------|--|--|

In Containment: No

Comment: ☐ Multiple Spills and Releases?**Equipment:**

| | | | |
|-----------------------|--|-------|-----------------|
| Type: Bird Protectors | # 2 | | corrective date |
| Comment: | <p>Previous inspections observed that protection equipment to prevent wildlife access to the secondary containment BMP at the 500 gallon Methanol tank, and the Separator stack were missing or inadequate. Inspection Required Operator to install or repair wildlife protection equipment by 7/18/2021.</p> <p>It was observed in this inspection that protection equipment to prevent wildlife access to the secondary containment BMP at the tank, and separator remain missing or inadequate.</p> | | |
| Corrective Action: | Install or repair wildlife protection equipment | Date: | 07/18/2021 |

Venting:

| | | | |
|----------|--|--|--|
| Yes/No | | | |
| Comment: | | | |

| | | | |
|--------------------|--|-------|--|
| Corrective Action: | | Date: | |
| Flaring: | | | |
| Type | | | |
| Comment: | | | |
| Corrective Action: | | Date: | |

Reclamation - Storm Water - Pit**Storm Water:**

| Loc Erosion BMPs | BMP Maintenance | Lease Road Erosion BMPs | Lease BMP Maintenance | Chemical BMPs | Chemical BMP Maintenance | Comment |
|------------------|-----------------|-------------------------|-----------------------|---------------|--------------------------|---------|
| | | | | | | |

Comment: Previous inspections observed that BMPs to protect and stabilize unpaved areas of the Location and access road, and to allow for proper stormwater discharge are missing, or insufficient; stormwater runoff resulted in erosion degradation and offsite sediment discharge at Location entrance and access road. Inspection required Operator to comply with Rule 1002.f.(2)C.

Snow cover prevented an accurate assessment of stormwater management on the Location; however, no Resolution Form has been submitted by Operator documenting that the corrective action has been addressed; control measures appear to remain missing or insufficient on sections of the access road that was visible; degradation remains evident.

Corrective Action: Install or repair required BMPs per Rule 1002.f.(2)C. Ensure control measures are installed in accordance with good engineering practices, and maintained in proper functioning condition.

Date: 07/20/2021

Pits: ☐ NO SURFACE INDICATION OF PIT

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

| Document Num | Description | URL |
|--------------|-------------------|---|
| 696203533 | Inspection Photos | http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5707257 |