

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

04/14/2022

Submitted Date:

04/18/2022

Document Number:

700600380

FIELD INSPECTION FORMLoc ID 321566 Inspector Name: Kosola, Jason On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**

OGCC Operator Number: 61650

Name of Operator: MURFIN DRILLING COMPANY INC

Address: 250 N WATER ST STE 300

City: WICHITA State: KS Zip: 67202

Status Summary:☐ THIS IS A FOLLOW UP INSPECTION☒ FOLLOW UP INSPECTION REQUIRED☐ NO FOLLOW UP INSPECTION REQUIRED**Findings:**

7 Number of Comments

4 Number of Corrective Actions

☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Schlagenhauf, Mark		mark.schlagenhauf@state.co.us	
Esquivel, James	620-272-4913	j280189@pld.com	
Morgan, John		john.morgan@state.co.us	
Rodak, Leon	316-858-8616	lrodak@murfininc.com	Principal Agent
Melland, Tom	316-858-8695	tmelland@murfininc.com	Production Engineer

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
150193	UIC DISPOSAL	AC	03/07/1988		-	LOWE 7-12	EI
207310	WELL	IJ	11/10/1987	DSPW	017-06245	LOWE 7-12	EI

General Comment:

Inadequate berms around tank battery.

Wellhead is partially buried by windblown sand.

Unused tank inside containment.

Unmarked, unused flowlines inside containment.

LocationOverall Good: ☐

Emergency Contact Number:

Comment: Corrective Action: Date: **Good Housekeeping:**

Type	STORAGE OF SUPL		
Comment:	Unused tank inside containment.		
Corrective Action:	Comply with Rule 606	Date:	07/18/2022
Type	OTHER		
Comment:	Flowlines inside containment. See attached photos. Improper abandonment of flowline or crude oil transfer line (not purged, depressurized, risers cut 3' below grade, ends sealed, equipment removed) per 1105. Disconnected flowline risers not OOSLAT (out of service locks and tags).		
Corrective Action:	Complete flowline and crude oil transfer line abandonments to comply with Rule 1105.	Date:	04/19/2022

Overall Good: ☐**Spills:**

Type	Area	Volume		
Crude Oil	Tank			
Comment:	Stained soil inside containment.			
Corrective Action:	Control and contain spills/releases and clean up per Rule 912.a.			Date: 05/19/2022

In Containment: Yes

Comment: ☐ Multiple Spills and Releases?**Tanks and Berms:**

Contents	#	Capacity	Type	Tank ID	SE GPS
Comment:					
Corrective Action:					Date:

Paint

Condition	<input type="text"/>
Other (Content)	<input type="text"/>
Other (Capacity)	<input type="text"/>
Other (Type)	<input type="text"/>

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Inadequate	Walls Insufficient	Base Sufficient	Inadequate
Comment:	Inadequate berms around tank battery.			
Corrective Action:	Repair or install berms or other secondary containment devices per Rule 912.d.(1).			Date: 05/28/2022

Venting:			
Yes/No			
Comment:			
Corrective Action:		Date:	

Flaring:			
Type			
Comment:			
Corrective Action:		Date:	

--	--	--	--

Inspected FacilitiesFacility ID: 150193 Type: UIC API Number: - Status: AC Insp. Status: EIFacility ID: 207310 Type: WELL API Number: 017-06245 Status: IJ Insp. Status: EI**Attached Documents**You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
700600381	Inspection photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5726454