

Document Number:  
 403057646

Date Received:

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Valerie Danson  
 Name of Operator: PDC ENERGY INC Phone: (970) 506-9272  
 Address: 1775 SHERMAN STREET - STE 3000 Fax: \_\_\_\_\_  
 City: DENVER State: CO Zip: 80203 Email: valerie.danson@pdce.com

**For "Intent" 24 hour notice required,** Name: Burns, Adam Tel: (970) 218-4885  
**COGCC contact:** Email: adam.m.burns@state.co.us

Type of Well Abandonment Report:  Notice of Intent to Abandon  Subsequent Report of Abandonment

API Number 05-123-26165-00  
 Well Name: GUTTERSEN Well Number: 34-6  
 Location: QtrQtr: SWSE Section: 6 Township: 3N Range: 63W Meridian: 6  
 County: WELD Federal, Indian or State Lease Number: \_\_\_\_\_  
 Field Name: WATTENBERG Field Number: 90750

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.249060 Longitude: -104.478190  
 GPS Data: GPS Quality Value: 1.7 Type of GPS Quality Value: \_\_\_\_\_ Date of Measurement: 10/19/2010

Reason for Abandonment:  Dry  Production Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_

Casing to be pulled:  Yes  No Estimated Depth: \_\_\_\_\_  
 Fish in Hole:  Yes  No If yes, explain details below  
 Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below  
 Details: \_\_\_\_\_

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	6576	6848			

Total: 1 zone(s)

**Casing History**

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	667	370	667	0	VISU
1ST	7+7/8	4+1/2	J55	10.5	0	6993	660	6993	394	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6526 with 2 sacks cmt on top. CIBP #2: Depth 2500 with 2 sacks cmt on top.  
 CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:

Perforate and squeeze at 380 ft. with 82 sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 (Cast Iron Cement Retainer Depth)

Set 130 sacks half in. half out surface casing from 1700 ft. to 0 ft. Plug Tagged:   
 Set \_\_\_\_\_ sacks at surface  
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
 Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_  
 Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105  Yes  No

#### Technical Detail/Comments:

Guttersen 34-6 (05-123-26165)/Plugging Procedure (Intent)  
 Producing Formation: Niobrara/Codell: 6576'-6848'  
 Upper Pierre Aquifer: 450'-1600'  
 TD: 7036' PBTD: 6837' (2/5/08)  
 Surface Casing: 8 5/8" 24# @ 667' w/ 370 sxs cmt  
 Production Casing: 4 1/2" 10.5# @ 6993' w/ 660 sxs cmt (TOC @ 394' - CBL)

Tubing: 2 3/8" tubing set @ 6827' (2/5/08)  
 Proposed Procedure:  
 1. MIRU pulling unit. Pull 2 3/8" tubing.  
 2. RU wireline company.  
 3. TIH with CIBP. Set BP at 6526'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Nio perms @ 6576')  
 4. TIH with CIBP. Set BP at 2500'. Top with 2 sxs 15.8#/gal CI G cement.  
 5. Wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or fluid migration, contact engineering before continuing operations.  
 6. TIH with perf gun. Shoot squeeze holes at 380'.  
 7. TIH with tubing to 1700'. RU cementing company. Mix and pump 130 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.  
 8. Close off casing returns. Hook up cement line to cement flange and pump 82 sxs 15.8#/gal CI G cement downhole and squeeze through perms at 380' into annular space. Cement should circulate to surface.  
 9. Well casing cut and capped per COGCC guidelines at a depth as not to interfere with soil cultivation.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Valerie Danson

Title: Reg Analyst

Date:

Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

<b>COA Type</b>	<b>Description</b>

**Attachment List**

<b>Att Doc Num</b>	<b>Name</b>
403057662	WELLBORE DIAGRAM
403057664	WELLBORE DIAGRAM

Total Attach: 2 Files

**General Comments**

<b>User Group</b>	<b>Comment</b>	<b>Comment Date</b>
		Stamp Upon Approval

Total: 0 comment(s)