

Document Number:  
 403113297  
 Date Received:

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322 Contact Name: Jess Jacobs  
 Name of Operator: NOBLE ENERGY INC Phone: (970) 744-1168  
 Address: 2001 16TH STREET SUITE 900 Fax: \_\_\_\_\_  
 City: DENVER State: CO Zip: 80202 Email: jessjacobs@chevron.com

**For "Intent" 24 hour notice required,** Name: Serna, Abe Tel: (720) 661-7317  
**COGCC contact:** Email: abe.serna@state.co.us

Type of Well Abandonment Report:  Notice of Intent to Abandon  Subsequent Report of Abandonment

API Number 05-123-17626-00  
 Well Name: ALLES Well Number: 33-7H5  
 Location: QtrQtr: SWNE Section: 33 Township: 5N Range: 65W Meridian: 6  
 County: WELD Federal, Indian or State Lease Number: 61544  
 Field Name: WATTENBERG Field Number: 90750

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.358097 Longitude: -104.665944  
 GPS Data: GPS Quality Value: 2.0 Type of GPS Quality Value: PDOP Date of Measurement: 06/12/2007  
 Reason for Abandonment:  Dry  Production Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_  
 Casing to be pulled:  Yes  No Estimated Depth: 1624  
 Fish in Hole:  Yes  No If yes, explain details below  
 Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below  
 Details: \_\_\_\_\_

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7042	7058			
NIOBRARA	6744	6868			
Total: 2 zone(s)					

**Casing History**

(Empty area for Casing History)

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	NA	23	0	504	400	504	0	VISU
1ST	7+7/8	3+1/2	B-70	7.7	0	7277	220	7277	6086	CBL
S.C. 1.1	7+7/8	3+1/2	B-70	7.7	0	7277	460	4388	3436	CBL

### Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6696 with 2 sacks cmt on top. CIBP #2: Depth 4024 with 2 sacks cmt on top.  
 CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 20 sks cmt from 2400 ft. to 2000 ft. Plug Type: CASING Plug Tagged:   
 Set 240 sks cmt from 704 ft. to 0 ft. Plug Type: CASING Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:

Perforate and squeeze at 2500 ft. with 170 sacks. Leave at least 100 ft. in casing 2402 CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 195 sacks half in. half out surface casing from 1624 ft. to 1124 ft. Plug Tagged:   
 Set \_\_\_\_\_ sacks at surface  
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
 Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_  
 Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_  
 \*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_  
 Type of Cement and Additives Used: \_\_\_\_\_  
 Flowline/Pipeline has been abandoned per Rule 1105  Yes  No

Technical Detail/Comments:

This well is part of the AOC (Order 1V-668) Alt MIT program.  
 3rd party wildlife surveys will be conducted on this well prior to rigging up for P&A activities.  
 Notification will be given to any adjacent building unit occupants within a 1000 feet of the wellhead of planned P&A start date.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Stephanie Dionne  
 Title: Operations Tech Date: \_\_\_\_\_ Email: stephanie.dionne@chevron.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: \_\_\_\_\_ Expiration Date: \_\_\_\_\_

<b>COA Type</b>	<b>Description</b>

**Attachment List**

<b>Att Doc Num</b>	<b>Name</b>
403113315	WELLBORE DIAGRAM
403113317	WELLBORE DIAGRAM

Total Attach: 2 Files

**General Comments**

<b>User Group</b>	<b>Comment</b>	<b>Comment Date</b>
		Stamp Upon Approval

Total: 0 comment(s)