

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

08/25/2022

Submitted Date:

08/29/2022

Document Number:

696204016**FIELD INSPECTION FORM**Loc ID: 322320 Inspector Name: Trujillo, Aaron On-Site Inspection: ☐ 2A Doc Num: _____**Operator Information:**OGCC Operator Number: 51130Name of Operator: LOCIN OIL CORPORATIONAddress: 600 TRAVIS ST STE 6161City: HOUSTON State: TX Zip: 77002**Status Summary:**☐ THIS IS A FOLLOW UP INSPECTION☒ FOLLOW UP INSPECTION REQUIRED☐ NO FOLLOW UP INSPECTION REQUIRED**Findings:**13 Number of Comments6 Number of Corrective Actions☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Pesicka, Conor		conor.pesicka@state.co.us	
Nicol, Michael	281-362-8600x116	mnicol@locinoil.com	All inspections

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
210271	WELL	SI	06/01/2020	GW	045-06027	GOVERNMENT 1	RI
322320	LOCATION	AC			-	GOVERNMENT-66S104W 35SWSW	RI

General Comment:

On 8/25/2022, Reclamation Specialist Trujillo inspected Locin Oil Corporations' Government #1 Location in Garfield County, Colorado.

This inspection is a follow-up to #696202842 to document compliance with the following corrective actions:

-Secondary Containment
-Weeds

Records show Well/Location transferred ownership to Locin Oil Corp #51130, effective 3/1/2022.

The following compliance issues were observed during this inspection:

-Signage (tanks, tank battery, well, etc..)
-Weeds
-Stormwater

Refer to the "Location" section of this inspection report for additional details.

Refer to the photo-documentation of the observed compliance issues attached to this report.

Any corrective action(s) from previous inspections that have not been addressed are still applicable.

A follow up inspection on this site will be conducted to ensure the compliance issues have been corrected to comply with COGCC rules.

Location			
Lease Road:			
Type	Access		
comment:	It was observed in this inspection that stormwater, erosion control and stabilization BMPs are missing or insufficient along entire access road- erosion degradation and sediment transport evident. Road provides access to Locin Oil Corp's Government 1, Government 2, as well as Utah Gas Corp's Federal Carbonera 1-2 Locations. Corrective action is being provided to all 3 Locations.		
Corrective Action:	Comply with 1002.f.; Implement and maintain BMPs to control stormwater runoff in a manner that minimizes erosion, transport of sediment offsite, and site degradation on access road. Ensure controls are implemented in accordance with good engineering practices and maintained in proper functioning condition; regrading alone will not be sufficient to stabilize road and manage runoff.		Date: 09/13/2022
Overall Good: <input type="checkbox"/>			
Signs/Marker:			
Type	TANK LABELS/PLACARDS		
Comment:	Signage/labels at the three tanks on the Location not posted or information is inaccurate.		
Corrective Action:	Comply with 605.h and post/label on all tanks with a capacity of 10 Barrels or greater, with the following information: A. Name of Operator; B. Operator's emergency contact telephone number; C. Tank capacity; D.Tank contents; and E.NFPA label or equivalent globally harmonized label. Lettering on all new Tanks, and on any reapplied or modified labels, will be legible from a distance of 100 feet.		Date: 09/29/2022
Type	BATTERY		
Comment:	Sign not posted or information inaccurate at battery; incorrect Operator information.		
Corrective Action:	Install sign to comply with Rule 605.e.		Date: 09/29/2022
Type	WELLHEAD		
Comment:	Sign not posted or information inaccurate at well; incorrect Operator information.		
Corrective Action:	Install sign to comply with Rule 605.d.		Date: 09/29/2022
Emergency Contact Number:			
Comment:	Emergency contact numbers listed on sign is for Foundation Energy; emergency contact information inaccurate. See CA for signage information above.		
Corrective Action:			Date:
Good Housekeeping:			
Type	WEEDS		
Comment:	Undesirable Plant Species (Russian thistle) observed establishing on the working pad areas, and along the access road		
Corrective Action:	Comply with Rule 606.c and keep Location and access road free of Undesirable Plant Species.		Date: 09/05/2022
Overall Good: <input type="checkbox"/>			
Spills:			
Type	Area	Volume	
	Tank	<= 1 bbl	
Comment:	Dark fluids observed within the secondary containment of the methanol tank next to well.		
Corrective Action:	Remove and properly dispose fluids within containment.		Date: 09/13/2022
In Containment: Yes			
Comment:			
<input type="checkbox"/> Multiple Spills and Releases?			

Fencing/:			
Type	TANK BATTERY		
Comment:	Panels		
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:	Panels		
Corrective Action:		Date:	

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS	
Comment:						
Corrective Action:						Date:

Paint

Condition		
Other (Content)		
Other (Capacity)		
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
		Walls Sufficient	Base Sufficient	Adequate
Comment:	Weeds/vegetation have been removed from the secondary containment BMP, and work to ensure BMP remains impervious has been conducted.			
Corrective Action:				
		Date:		

Venting:

Yes/No		
Comment:		
Corrective Action:		Date:

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Inspected Facilities

Facility ID: 210271	Type: WELL	API Number: 045-06027	Status: SI	Insp. Status: RI
---------------------	------------	-----------------------	------------	------------------

Facility ID: 322320	Type: LOCATION	API Number: -	Status: AC	Insp. Status: RI
---------------------	----------------	---------------	------------	------------------

COGCC Comments

Comment	User	Date
<p>Collaborate with Utah Gas Corp regarding necessary work to comply with 1002.f along access road, between the turn-off of CR 201 and the Federal-Carbonera 1-2. Locin Oil remains responsible for maintenance of the road leading north of the Fed.-Car. 1-2, to the Government #1 and #2 Locations.</p> <p>Refer to inspection nos. 696204020 and 696204018 for additional details.</p>	trujilloam	08/29/2022

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
696204017	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5842207