

**FORM  
INSP**Rev  
X/20**State of Colorado  
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

09/22/2022

Submitted Date:

09/23/2022

Document Number:

696204135

**FIELD INSPECTION FORM**Loc ID 445862 Inspector Name: Trujillo, Aaron On-Site Inspection ☐ 2A Doc Num: \_\_\_\_\_**Operator Information:**

OGCC Operator Number: 10456

Name of Operator: CAERUS PICEANCE LLC

Address: 1001 17TH STREET #1600

City: DENVER State: CO Zip: 80202

**Status Summary:**

- ☒ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

**Findings:**

4 Number of Comments

1 Number of Corrective Actions

- ☒ Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM  
PREVIOUS INSPECTIONS THAT HAVE NOT  
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
,		COGCC.inspections@caerus oilandgas.com	All Inspections

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
445862	LOCATION	AC			-	Mesa P24-697	RI

**General Comment:**

On 9/22/2022 Reclamation Specialist Trujillo inspected Caerus Piceance's Mesa P24-697 location in Garfield County, Colorado.

This is also a follow-up inspection to #696204042, to document compliance for the following corrective actions:  
-Stormwater

It was observed that the Location remains out of compliance with COGCC Rules and corrective actions

Refer to the "Stormwater" section of this inspection report for additional details.

Refer to the photo-documentation of the observed compliance issues attached to this report.

Any corrective action(s) from previous inspections that have not been addressed are still applicable.

A follow up inspection on this site will be conducted to ensure the compliance issues have been corrected to comply with COGCC rules.



**Reclamation - Storm Water - Pit****Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment

Comment: [See "COGCC Comments"](#)Corrective Action: [Comply with 1002.f](#)

Date: 09/09/2022

**Pits:** ☐ NO SURFACE INDICATION OF PIT**COGCC Comments**

Comment	User	Date
<b>STORMWATER COMMENTS</b>  Inspection #696204042 observed that stormwater and erosion control BMPs were missing or insufficient on the Location: -Sediment traps on the north end of the Location have not been constructed with a properly engineered inlet and outlet; inlet/outlet have not been constructed with a geotextile lining in conjunction with rip-rap armoring per good engineering practices, resulting in erosion degradation beneath the rock material; degradation also observed below the armored section of the inlet leading into the sediment trap. Inspection required Operator to comply with Rule 1002.f by 9/8/2022.  It was observed in this inspection that work to address the CA is inadequate; though the erosion degradation appears to have been repaired, the sediment trap BMPs have not been installed in accordance with good engineering practices; Operator installed rock (rip-rap) to armor both the inlets/outlets of the traps, however, rip-rap has not been installed in conjunction with geotextile lining per good engineering practices.  This CA has not been addressed and remains applicable.	trujilloam	09/23/2022

**Attached Documents**You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
696204136	Inspection Photos	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5868867">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5868867</a>