

Inspection Photos

API: 071-07915

Operator: WAPITI OPERATING LLC

Inspection Date: 9/23/2022



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-07915 | Date: 9/23/2022

Inspection Photos



Photo 1. Facing south along the main road. There is erosion occurring along the road side. BMP's need to be installed to prevent erosion.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-07915 | Date: 9/23/2022

Inspection Photos



Photo 2. Facing west toward near the access road ascending the hillside. The culvert outlet has been washed out from recent storm event. It appears a larger culvert is needed along with larger rock rip/rap outlet protection.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-07915 | Date: 9/23/2022

Inspection Photos



Photo 3. The culvert inlet is filled in with sediment and debris. It appears a larger culvert is needed at this area to handle stormwater coming off the road and drainage.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-07915 | Date: 9/23/2022

Inspection Photos



Photo 4. There are signs stormwater is flowing down the road causing erosion. This area has been a problem before. Stormwater is not being properly diverted off the road.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-07915 | Date: 9/23/2022

Inspection Photos



Photo 5. Facing west along the access road. Some of the rock check dams previously installed have washed out. Larger rock was likely needed. A 4.5 ft. shovel shows scale of erosion.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-07915 | Date: 9/23/2022

Inspection Photos



Photo 6. Further along the road facing back east. There is stormwater erosion occurring down the road which will continue to worsen since the previous inspection.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-07915 | Date: 9/23/2022

Inspection Photos



Photo 7. Facing southwest toward the location.



Inspection Photos



Photo 8. There are still noxious weeds Hounds tongue and Canada thistle which have not been controlled. The noxious weeds have produced seed so the weeds should also be bagged and removed.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-07915 | Date: 9/23/2022

Inspection Photos



Photo 9. There numerous noxious weeds along the cut slope which have begun to seed out. Red arrow points to Canada thistle.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-07915 | Date: 9/23/2022