

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Document Number:
403200224

Date Received:
10/18/2022

FIR RESOLUTION FORM

Overall Status:

CA Summary:

1 of 1 CAs from the FIR responded to on this Form

1 CA Completed
0 Factual Review Request

OPERATOR INFORMATION

OGCC Operator Number: 96850

Name of Operator: TEP ROCKY MOUNTAIN LLC

Address: 1058 COUNTY ROAD 215

City: PARACHUTE State: CO Zip: 81635

Contact Name and Telephone:

Name: _____

Phone: () Fax: ()

Email: _____

Additional Operator Contact:

Contact Name

Phone

Email

TEP

COGCCInspectionReports@terraep.com

COGCC INSPECTION SUMMARY:

FIR Document Number: 699805017

Inspection Date: 10/07/2022

FIR Submit Date: 10/07/2022

FIR Status: _____

Inspected Operator Information:

Company Name: TEP ROCKY MOUNTAIN LLC

Company Number: 96850

Address: 1058 COUNTY ROAD 215

City: PARACHUTE State: CO Zip: 81635

LOCATION - Location ID: 335054

Location Name: CSF-67S91W Number: 8SESW County: _____

Qtrqtr: SESW Sec: 8 Twp: 7S Range: 91W Meridian: 6

Latitude: 39.454919 Longitude: -107.578976

FACILITY - API Number: 05-045-00 Facility ID: 335054

Facility Name: CSF-67S91W Number: 8SESW

Qtrqtr: SESW Sec: 8 Twp: 7S Range: 91W Meridian: 6

Latitude: 39.454919 Longitude: -107.578976

CORRECTIVE ACTIONS:

1 CA# 165141

Corrective Action: Oil and gas operators shall implement and maintain Best Management Practices (BMPs) at all oil and gas locations

Date: 10/21/2022

Response: CA COMPLETED

Date of Completion: 10/10/2022

Operator
Comment:

Per the production supervisor for this location, the site is stable and BMPs are functioning as designed. The site was simply wet and muddy at the time that the COGCC inspector accessed the location. As needed, the location is periodically bladed to remove any ruts that were created by traffic accessing the location during / soon after a storm event.

COGCC Decision: _____

COGCC
Representative:

OPERATOR COMMENT AND SUBMITTAL

Comment: Per the production supervisor for this location, the site is stable and the BMPs are functioning as designed. The site was simply wet and muddy at the time that the COGCC inspector accessed the location. As needed, the location is periodically bladed to remove any ruts that were created by traffic accessing the location during / soon after a storm event, and to maintain other BMPs as required. BMPs are designed to reduce and minimize sediment transport, not to completely prevent and eliminate sediment movement. This corrective action item has been addressed.

I hereby certify that the statements made in this form are, to the best of my knowledge, true, correct, and complete.

Print Name: Michael Gardner

Signed: _____

Title: TEP Environmental Lead

Date: 10/18/2022 9:34:19 AM

ATTACHMENT LIST

View Attachments in Imaged Documents on COGCC website (<http://ogccweblink.state.co.us/>) - Search by Document Number.

Document Number **Description**

--	--

Total Attach: 0 Files