

Construction and Stormwater Inspection

Date: 10/11/2022

Operator: VERDAD RESOURCES LLC - 10651

Location ID: 441041

Inspection Document #: 696105543

Weld County, CO

SWSW Section 30 T9N R59W

Dylan Edwardson
Reclamation Specialist, COGCC



COLORADO

**Oil & Gas Conservation
Commission**

Department of Natural Resources

Inspection Photos
Location Name: Martin 3030-3031
Location ID: 441041



Photo 1. Taken near entrance, facing north. Photo illustrates operator has performed corrective actions and has stabilized inlet and outlets of culverts.

Inspection Photos
Location Name: Martin 3030-3031
Location ID: 441041



Photo 2. Taken near entrance, facing south. Photo illustrates operator has performed corrective actions and has stabilized inlet and outlets of culverts.

Inspection Photos
Location Name: Martin 3030-3031
Location ID: 441041



Photo 3. Taken from southeast corner of location, facing southwest. Photo illustrates straw wattles are not installed per good engineering practices (e.g. not staked, not trenched).

Inspection Photos
Location Name: Martin 3030-3031
Location ID: 441041



Photo 4. Taken from southeast corner of location, facing west. Photo illustrates rill erosion occurring on south slope of berm and sediment laden stormwater discharging off location.

Inspection Photos
Location Name: Martin 3030-3031
Location ID: 441041



Photo 5. Taken from southeast corner of location, facing north. Photo illustrates Operator has performed corrective actions with no evidence of unconsolidated material on the berm portion of BMP.

Inspection Photos
Location Name: Martin 3030-3031
Location ID: 441041



Photo 6. Taken from southwest portion of location, facing southwest. Photo illustrates detention area and stabilized slopes.

Inspection Photos
Location Name: Martin 3030-3031
Location ID: 441041



Photo 7. Taken from center of location, facing northwest. Photo illustrates topsoil stockpile has been stabilized with evidence of seeding and straw crimped mulch.

Inspection Photos
Location Name: Martin 3030-3031
Location ID: 441041



Photo 8. Taken from western portion, facing north. See comments in photo 7.

Inspection Photos
Location Name: Martin 3030-3031
Location ID: 441041



Photo 9. Taken from northwestern corner of location, facing south. See comments in photo 7.

Inspection Photos
Location Name: Martin 3030-3031
Location ID: 441041



Photo 10. Taken from northeast corner of location, facing west. Photo illustrates Operator has performed corrective actions with no evidence of unconsolidated material on the berm portion of BMP; material seems to have been compacted.

Inspection Photos
Location Name: Martin 3030-3031
Location ID: 441041



Photo 11. Taken from northeast corner of location, facing south. See comments in photo 10.

Inspection Photos
Location Name: Martin 3030-3031
Location ID: 441041



Photo 12. Taken near northeast corner of location, facing west. Photo illustrates approximate 20' x 20' area of concrete washout. This need to be cleaned and properly disposed of.

Inspection Photos
Location Name: Martin 3030-3031
Location ID: 441041



Photo 13. Taken near center of location, facing southeast. Tank has shifted and needs to be uprighted. No apparent fluid/material in tank, and no visible leaks on ground during time of inspection.