

# Inspection Photos and Issue Report

11/1/2022

Operator: GUNNISON ENERGY LLC #10515

Location #427218

Gunnison County, CO

Aaron Trujillo

NW Reclamation Specialist

COGCC

Inspection Photos  
Operator Name: GUNNISON ENERGY LLC #10515  
Location #427218



**Photo 1:** Photos taken from the Location entrance. Photo shows required delayed IR variance signage per Form 4 #401463099 conditions of approval has not been posted at the Location entrance. Signs observed in photo is required Location signage.

Inspection Photos  
Operator Name: GUNNISON ENERGY LLC #10515  
Location #427218



November 1, 2022



November 1, 2022

**Photo 2:** Photos taken from the north end of the Location, at the location entrance. Photo shows stormwater runoff has resulted in erosion degradation to the slopes. BMPS missing or insufficient.

Inspection Photos  
Operator Name: GUNNISON ENERGY LLC #10515  
Location #427218



**Photo 3:** Photo taken from the northwest end of the Location. Photo shows stormwater runoff has resulted in a gully erosion and degradation. 6 and ½ foot measuring stick used for reference.

Inspection Photos  
Operator Name: GUNNISON ENERGY LLC #10515  
Location #427218



**Photo 4:** Photo taken from the northwest end of the Location. Photo shows stormwater runoff has resulted in a gully erosion and degradation. 6 and ½ foot measuring stick used for reference.

Inspection Photos  
Operator Name: GUNNISON ENERGY LLC #10515  
Location #427218



**Photo 5:** Photo taken from the northwest end of the Location. Photo shows the stormwater diversion ditch is not in proper functioning condition; stormwater runoff appears to be either being diverted and discharging onto the working pad areas of the Location, rather than off-location, or area and ditch/berm has not been properly engineered to facilitate stormwater discharge to leave the pad.