

Inspection Photos

API: 071-08419

Operator: OGRIS OPERATING LLC

Inspection Date: 11/30/2022



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-08419 | Date: 11/30/2022

Inspection Photos



Photo 1. Facing northwest toward the access road. The erosion on the road has been repaired and diversion has been installed off the road side with rip/rap.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-08419 | Date: 11/30/2022

Inspection Photos



Photo 2. There has been rock check dams installed along the road side where erosion was occurring. There is concerns with the check dam installation Stormwater can erode around the check dams. Installation should be from bank to bank, keyed in, with low point in the middle.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-08419 | Date: 11/30/2022

Inspection Photos



Photo 3. This area along the road may need to be dug out more to ensure stormwater flows into the diversion shown at red arrow.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-08419 | Date: 11/30/2022

Inspection Photos



Photo 4. Further up the road. The loose soils on the roadside should be seeded for stabilization.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-08419 | Date: 11/30/2022

Inspection Photos



Photo 5. Further up the road a culvert was installed which will help with concentrated flows along this area. There is concerns that stormwater will overtop the embankment at red arrow which should be built up better and compacted.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-08419 | Date: 11/30/2022

Inspection Photos



Photo 6. There is no outlet protection installed at the newly installed culvert.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

API: 071-08419 | Date: 11/30/2022