

# Inspection Photos

3/21/2023

Operator: CAERUS PICEANCE LLC #10456

Location #335780

Garfield County, CO

Aaron Trujillo

NW Reclamation Specialist

COGCC

Inspection Photos  
Operator Name: CAERUS PICEANCE LLC #10456  
Location #335780



**Photo 1:** Photos 1-4 taken from the working pad area of the Location. Photos examples showing BMPs, including vehicle tracking control measures, remain missing or insufficient to minimize erosion, degradation, tracking and sediment transport during wet conditions. Regrading alone is inadequate to address tracking and stabilization issues. 6 foot measuring stick for reference.



Inspection Photos  
Operator Name: CAERUS PICEANCE LLC #10456  
Location #335780



**Photo 2:** See comments under photo 1.

Inspection Photos  
Operator Name: CAERUS PICEANCE LLC #10456  
Location #335780



March 21, 2023

**Photo 3:** See comments under photo 1.



Inspection Photos  
Operator Name: CAERUS PICEANCE LLC #10456  
Location #335780



**Photo 4:** See comments under photo 1.



Inspection Photos  
Operator Name: CAERUS PICEANCE LLC #10456  
Location #335780



**Photo 5:** Photo taken from the east end of the Location. Photo shows areas where stormwater is ponding on the east end of the Location. There are several areas where stormwater has blown out the perimeter berm, resulting erosion, degradation, and sediment deposition on top of vegetation of the interim slopes of the Location; Location has not been constructed with an appropriate engineered outlet to allow for proper stormwater discharge.



Inspection Photos  
Operator Name: CAERUS PICEANCE LLC #10456  
Location #335780



March 21, 2023

**Photo 6:** See comments under photo 5. Photo shows areas where stormwater has blown out the perimeter berm, resulting erosion and degradation the interim slopes of the Location; Location has not been constructed with an appropriate engineered outlet to allow for proper stormwater discharge.

Inspection Photos  
Operator Name: CAERUS PICEANCE LLC #10456  
Location #335780



**Photo 7:** See comments under photo 5. Photo shows areas where stormwater has blown out the perimeter berm, resulting erosion and degradation the interim slopes of the Location; Location has not been constructed with an appropriate engineered outlet to allow for proper stormwater discharge.



Inspection Photos  
Operator Name: CAERUS PICEANCE LLC #10456  
Location #335780



**Photo 8:** See comments under photo 5. Photo shows areas where stormwater has blown out the perimeter berm, resulting erosion and degradation the interim slopes of the Location; Location has not been constructed with an appropriate engineered outlet to allow for proper stormwater discharge.



Inspection Photos  
Operator Name: CAERUS PICEANCE LLC #10456  
Location #335780



**Photo 9:** Photo shows stormwater erosion and degradation at the eastern interim slopes of the Location. Location has not been constructed with an appropriate engineered outlet to allow for proper stormwater discharge.



Inspection Photos  
Operator Name: CAERUS PICEANCE LLC #10456  
Location #335780



**Photo 10:** See comments under photo 9.



Inspection Photos  
Operator Name: CAERUS PICEANCE LLC #10456  
Location #335780



**Photo 11:** See comments under photo 9. Hardhat used for reference



Inspection Photos  
Operator Name: CAERUS PICEANCE LLC #10456  
Location #335780



**Photo 12:** Photos taken from the sediment trap on the west end of the Location. Photo shows BMP appears to have filled with sediment.



## Inspection Photos

Operator Name: CAERUS PICEANCE LLC #10456

Location #335780



**Photo 13:** Continued from photo 12. Photo shows outlet at the sediment trap in disrepair. BMP also does not appear to have been constructed in accordance with good engineering practices; geotextile lining not observed beneath armoring.



**COLORADO**  
Oil & Gas Conservation  
Commission  
Department of Natural Resources



Inspection Photos  
Operator Name: CAERUS PICEANCE LLC #10456  
Location #335780



**Photo 14:** Photo shows areas where stormwater appears to have blown out a section of the sediment trap, resulting in runoff onto the working pad area and sediment deposition.



Inspection Photos  
Operator Name: CAERUS PICEANCE LLC #10456  
Location #335780



**Photo 15:** Photos 15-16 show BMPs to minimize erosion, degradation, tracking and sediment transport remain missing or insufficient at the access road. Degradation/tracking and sediment transport observed throughout many sections of the main north/south access road. Stormwater does not appear to be being adequately diverted, or discharging from the road. Grading alone is inadequate to address tracking and stabilization issues.



Inspection Photos  
Operator Name: CAERUS PICEANCE LLC #10456  
Location #335780



**Photo 16:** Photo taken example of sections along the main North/South access road, where BMPs to minimize erosion, degradation, tracking and sediment transport remain missing or insufficient. Stormwater does not appear to be being adequately diverted, or discharging from the road. Regrading alone is inadequate to address tracking and stabilization issues. 6 foot measuring stick for reference. Riparian area for Parachute Creek visible in the left of the photo.