

Inspection Photos

3/31/2023

Operator: LOCIN OIL CORPORATION - 51130

Location #322414

Garfield County, CO

Aaron Trujillo

NW Reclamation Specialist

COGCC

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



Photo 1: Photos 1-2 taken from the south end of the Location. Photos provide an overview of the Location from west, northwest, northeast to east.

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



Photo 2: See comments under photo 1.

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



Photo 3: Incorrect Operator information on tank.

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



Photo 4: Holes observed in netting at pit; BMP not in proper functioning condition.

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



Photo 5: Photo taken from the methanol tank adjacent to the wellhead. Photo shows the wildlife protection BMP (wire fence/net) at the tank has not been properly secured to the containment BMP, which has resulted in bird mortality within the secondary containment.

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



Photo 6: Continued from photo 5. Photo shows wildlife (bird) mortality due to improperly installed/maintain wildlife protection BMPs; bird species observed appears to be Spotted Towhee (*Pipilo maculatus*). Photo also shows containment BMP has filled with fluids, and is not longer adequate to contain a spill.

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



Photo 7: Photo shows erosion degradation due to stormwater runoff on the access road. 6 foot measuring stick for reference. Road lacks stabilization.

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



Photo 8: Photo shows gully erosion degradation due to stormwater runoff on the access road. 6 foot measuring stick for reference. Road lacks stabilization.

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



March 31, 2023

Photo 9: Gully erosion at access road. Photo shows gully depth on that road itself is approximately 2 feet deep. Road lacks stabilization.

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



Photo 10: Photos 10-12 shows a section of the access road that runs parallel to “Salt Creek”. Stormwater runoff has resulted in erosion degradation and stabilization concerns; areas of access road at risk of sloughing into Salt Creek

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



Photo 11: See comments under photo 10. Photo shows point where stormwater cuts directly beneath the access road. Reclamation Specialist was unable to determine depth of the hole.

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



Photo 12: See comments under photo 10. Photo shows areas of access road (right of line) at risk of eroding into Salt Creek (left of line). Road lacks stabilization.

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



Photo 13: Erosion degradation on access road; stormwater and erosion control BMPs missing or insufficient. Road lacks stabilization.

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



Photo 14: Erosion degradation on access road; stormwater and erosion control BMPs missing or insufficient. Road lacks stabilization.

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



Photo 15: Erosion degradation on access road; tracking controls missing or insufficient; rutting evident. Road lacks stabilization.

Inspection Photos
Operator Name: LOCIN OIL CORPORATION - 51130
Location #322414



Photo 16: Erosion degradation on access road; tracking controls missing or insufficient; rutting evident. Road lacks stabilization.