

**FORM
INSP**

Rev
X/20

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

03/27/2023

Submitted Date:

03/29/2023

Document Number:

699805498

FIELD INSPECTION FORM

Loc ID 334570 Inspector Name: De Paolo, Corey On-Site Inspection 2A Doc Num: _____

Status Summary:

THIS IS A FOLLOW UP INSPECTION

FOLLOW UP INSPECTION REQUIRED

NO FOLLOW UP INSPECTION REQUIRED

Findings:

17 Number of Comments

4 Number of Corrective Actions

Corrective Action Response Requested

Operator Information:

OGCC Operator Number: 96850

Name of Operator: TEP ROCKY MOUNTAIN LLC

Address: 1058 COUNTY ROAD 215

City: PARACHUTE State: CO Zip: 81635

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
, TEP		COGCCInspectionReports@terraep.com	

General Comment:

COGCC Inspection Report Summary
On 3/24/23 at approximately 13:30 hours, I, Inspector Corey De Paolo, Conducted an on-site inspection at TEP ROCKY MOUNTAIN LLC PUCKETT/TOSCO-66S95W /34NESW. Location #334570 Garfield County Colorado
While there, I observed normal production operations.
During this inspection the following compliance issues were observed:

- 1) Calibration cards not conspicuously posted with a corrective action date of 4/6/23.
- 2) Loadline open ended with a corrective action date of 4/3/23.
- 3) Capacity reduced due to stormwater in tank containment with a corrective action date of 4/26/23.
- 4) -Location lacks stabilization.

- Insufficient tracking BMP at entrance to location. To minimize the transport of sediment.
- Berms insufficient
- Run on to location is not being controlled with a corrective action date of 4/11/23.

- Location is located in a high priority habitat area.

A follow up on this site inspection needs to be conducted to ensure the Compliance issues have been corrected to comply with COGCC rules.
This is a summary of the inspection report

Location

Lease Road:			
Type	Access		
comment:			
Corrective Action			Date:

Overall Good:

Signs/Marker:			
Type	WELLHEAD		
Comment:			
Corrective Action:			Date:
Type	OTHER		
Comment:	Separator units include attached storage tanks. The sight glass located on the side of the unit indicates the storage tank is full of an unknown fluid. No form of labeling or markers are present to identify a potential hazard or the contents of the storage tank. Remove and properly dispose of all stained soils and gravel from location.		
Corrective Action:			Date:
Type	TANK LABELS/PLACARDS		
Comment:			
Corrective Action:			Date:
Type	BATTERY		
Comment:			
Corrective Action:			Date:

Emergency Contact Number:			
Comment:	911/970-285-9377		
Corrective Action:			Date: _____

Overall Good:

Spills:			
Type	Area	Volume	
In Containment: No			
Comment:			
<input type="checkbox"/> Multiple Spills and Releases?			

Fencing/:			
Type	WELLHEAD		
Comment:	hog panels		
Corrective Action:			Date:
Type	SEPARATOR		
Comment:	Hog panels		
Corrective Action:			Date:
Type	TANK BATTERY		
Comment:	hog panels		

Corrective Action:		Date:	
Equipment:			corrective date
Type: Bradenhead	# 3		
Comment:	Taylor plugs located on braden head. All braden head valves are accessible.		
Corrective Action:		Date:	
Type: Horizontal Heated Separator	# 3		
Comment:			
Corrective Action:		Date:	
Type: Gas Meter Run	# 3		
Comment:	Calibration cards not conspicuously posted.		
Corrective Action:	The Operator will conspicuously post and maintain the date of the last meter calibration.		Date: 04/06/2023
Type: Other	# 1		
Comment:	Loadline open ended.		
Corrective Action:	All loadlines will be bullplugged or capped.		Date: 04/03/2023
Type: Plunger Lift	# 3		
Comment:	All wells on plunger lift		
Corrective Action:		Date:	
Type: Bird Protectors	# 3		
Comment:			
Corrective Action:		Date:	

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS
PRODUCED WATER	1	300 BBLs	STEEL AST		,
Comment:					
Corrective Action:					Date:

Paint

Condition	Adequate	
Other (Content)		
Other (Capacity)		
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Metal	Inadequate	Walls Sufficient	Base Sufficient	Inadequate
Comment:	Capacity reduced due to stormwater in tank containment.			
Corrective Action:	Operators will design secondary containment structures to be sufficiently sized to contain at least 150% of the volume of the largest single Tank within the containment.			Date: 04/27/2023

Venting:

Yes/No	NO	
Comment:		
Corrective Action:		Date:

Flaring:			
Type			
Comment:			
Corrective Action:		Date:	

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
		Culverts				
Ditches						
Gravel						
		Sediment Traps				
		Gravel				
Other	Fail					-Run on to location is not being controlled.
Berms	Fail					-Berm insufficient
Sediment Traps						
		Ditches				
Compaction	Fail					-Location lacks stabilization
		Berms				
Other	Fail					-Insufficient tracking BMP at entrance

Comment:
 -Location lacks stabilization.
 -Insufficient tracking BMP at entrance to location. To minimize the transport of sediment.
 -Berms insufficient
 -Run on to location is not being controlled.

Corrective Action: **Oil and gas operators shall implement and maintain Best Management Practices (BMPs) at all oil and gas locations in a manner that minimizes erosion, transport of sediment off site and site degradation.**

Date: 04/11/2023

Pits: NO SURFACE INDICATION OF PIT

COGCC Comments

Comment	User	Date
Refer to Equipment and stormwater for corrective actions.	depaoloc	03/27/2023

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
403359856	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6065774
699805499	Photos for Insp. #699805498	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6065772
699805500	Storm water photo log Insp. #699805498	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6065773