

Construction and Stormwater Inspection

Date: 05/03/2023

Operator: VERDAD RESOURCES LLC -10651

Location ID: 468727

Inspection Document #: 708200223

Weld County, CO

NWNE Section 1 T9N R59W

Dylan Edwardson
Reclamation Specialist, COGCC



COLORADO

**Oil & Gas Conservation
Commission**

Department of Natural Resources

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photos 1 & 2. Rill erosion is evident at the entrance to the location. The inlet/outlets of the culvert will need to be properly stabilized/protected to prevent further erosion from occurring. Also pictured, undesirable plant debris that will need to be removed and managed for during the next local growing season.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photos 3 & 4. Rill erosion at culvert (left) and animal burrows in the interior stormwater berm (right); see comments in Photos 1 & 2 for additional information.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 5. Undesirable vegetation in the ditch that does not appear to have been managed during the previous growing season.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 6. Animal carcass found on location will need to be properly disposed of/removed from location.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 7. Examples of trash observed on location. The Operator shall self inspect the entire location and remove any trash in compliance with Rule 606.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 8. Topsoil stockpile does not appear to be properly stabilized per Rule 1002.c. Additional BMPs will need to be implemented to stabilize the topsoil.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 9. Northwest corner of the location. Degraded straw wattles are no longer properly functioning or installed per good engineering practices and are now considered trash/debris. Inlet/outlets do not appear to be stabilized and the berm material needs additional work to ensure the soil is protected against wind and water erosion as bare soil is not adequate.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 10. See comments in Photo 9.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 11. Topsoil stockpile void of any protections and/or vegetation and undesirable plant species observed in the stormwater ditch.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 12. From top of stockpile; see comments in Photo 8.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 13. See comments in Photo 8.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 14. Cut slopes and perimeter stormwater controls will need to be properly stabilized and undesirable vegetation will need to be managed during the next growing season.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 15. Trash found in ditch.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 16. See comments in Photo 15.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 17. See comments in Photo 15.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 18. See comments in Photo 14.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 19. Cut slopes and stormwater BMPs will need to be properly stabilized to protect against wind and water erosion. Degraded straw wattles do not appear adequate and will require maintenance, repairs, or replacements.

Inspection Photos
Location Name: Timbro 0101
Location ID: 468727



Photo 20. At the time of this inspection, cellars did not have any wildlife exclusion devices installed.