

**FORM
INSP**

Rev
X/20

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

05/03/2023

Submitted Date:

05/04/2023

Document Number:

690204174

FIELD INSPECTION FORM

Loc ID 321029 Inspector Name: COSTA, RYAN On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

OGCC Operator Number: 10626
Name of Operator: DOVER ATWOOD CORPORATION
Address: 1875 HARSH AVENUE SE
City: MASSILLON State: OH Zip: 44646

Findings:

- 5 Number of Comments
- 2 Number of Corrective Actions
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
COGCC Enforcement		dnr_cogccenforcement@state.co.us	
GEORGE KELLY		envexbaca@aol.com	
JOHN LEVENGOOD		jlevengood07@gmail.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
205821	WELL	PR	12/01/2014	GW	009-06236	PACKARD 1-X	RI

General Comment:

This is a follow up of the previous inspections and in regard to NOAV #403123726, #403117306.
See attached photos and additional details within this report.

Location

Overall Good:

Signs/Marker:

Type	WELLHEAD		
Comment:	There is an updated sign installed but the sign does not meet the requirements of Rule 605.d. No API #, local emergency services #, public road used to access the well. Previous corrective action is not completed.		
Corrective Action:	Install sign to comply with Rule 605.d.	Date:	03/02/2022

Emergency Contact Number:

Comment:	<input style="width: 95%;" type="text"/>		
Corrective Action:	<input style="width: 95%;" type="text"/>	Date:	<input style="width: 95%;" type="text"/>

Good Housekeeping:

Type	UNUSED EQUIPMENT		
Comment:	There is an uncapped pipe riser where the tank was removed from. The pipe riser needs to be removed. Previous corrective action not completed.		
Corrective Action:	Comply with 1100 Rules.	Date:	09/15/2022

Overall Good:

Spills:

Type	Area	Volume			

In Containment: No

Comment:

Multiple Spills and Releases?

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS	
Comment:	The broken tank has been removed. If a new tank is installed, it must comply with Rule 603.k.					
Corrective Action:						Date:

Paint

Condition	<input style="width: 95%;" type="text"/>		
Other (Content)	<input style="width: 95%;" type="text"/>		
Other (Capacity)	<input style="width: 95%;" type="text"/>		
Other (Type)	<input style="width: 95%;" type="text"/>		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Comment:	Secondary containment will need to be installed if a new tank is installed per 603.o.			
Corrective Action:				
				Date:

Venting:

Yes/No	<input style="width: 95%;" type="text"/>		
Comment:	<input style="width: 95%;" type="text"/>		

Corrective Action:		Date:	
--------------------	--	-------	--

Flaring:

Type	
Comment:	
Corrective Action:	
	Date:

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
403394502	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6104665
690204175	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6104659