

**FORM  
INSP**Rev  
X/20**State of Colorado  
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

05/08/2023

Submitted Date:

05/09/2023

Document Number:

696204909

**FIELD INSPECTION FORM**Loc ID 322414 Inspector Name: Trujillo, Aaron On-Site Inspection ☐ 2A Doc Num: \_\_\_\_\_**Operator Information:**

OGCC Operator Number: 51130

Name of Operator: LOCIN OIL CORPORATION

Address: 600 TRAVIS ST STE 6161

City: HOUSTON State: TX Zip: 77002

**Status Summary:**

- ☒ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

**Findings:**

13 Number of Comments

1 Number of Corrective Actions

- ☒ Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM  
PREVIOUS INSPECTIONS THAT HAVE NOT  
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
		ttaylor@locin.energy	
		dbenedict@locin.energy	
		hsirvent@locinoil.com	

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
210444	WELL	SI	06/01/2020	GW	045-06200	FEDERAL 12-3	RI
322414	LOCATION	AC			-	FEDERAL-68S104W 3SWNW	RI

**General Comment:**

On 5/8/2023, Reclamation Specialist Trujillo Reclamation Specialist Trujillo inspected Locin Oil Corporation's FEDERAL #12-3 Location in Garfield County, Colorado.

This is also a follow-up inspection to #696204815, to document compliance for the following corrective actions:

- Wildlife Mortality
- Inadequate wildlife protection BMPs
- Inadequate containment BMP
- Tank signage/labeling
- Stormwater

It was observed that the Location remains out of compliance with COGCC Rules and Corrective Actions

The following compliance issues were observed during this inspection:

Refer to the "Location" and "Stormwater" sections of this inspection report for additional details.

Refer to the photo-documentation of the observed compliance issues attached to this report.

Any corrective action(s) from previous inspections that have not been addressed are still applicable.

A follow up inspection on this site will be conducted to ensure the compliance issues have been corrected to comply with COGCC rules.

**Location**Overall Good: ☒

<b>Signs/Marker:</b>			
Type	WELLHEAD		
Comment:			
Corrective Action:		Date:	
Type	TANK LABELS/PLACARDS		
Comment:	<p>Previous inspection observed a that the sign or label information was not posted, or information inaccurate on the produced water tank. Inspection required Operator to comply with Rule 605.h</p> <p>It was observed in this inspection that the Operator Name information has been updated, however the required Operator's emergency contact telephone number remains missing. Corrective action requiring Operator to comply with Rule 605.h has not been addressed, and remains applicable.</p> <p>produced water tank. Inspection required Operator to comply with Rule 605.h.</p>		
Corrective Action:	Comply with 605.h	Date:	05/04/2023
Type	BATTERY		
Comment:			
Corrective Action:		Date:	
Type	CONTAINERS		
Comment:	<p>Previous inspection observed a methanol tank stored adjacent to the wellhead missing required labeling. Inspection required Operator to comply with Rule 605.h.</p> <p>It was observed in this inspection that the container has been removed; corrective action is no longer applicable.</p>		
Corrective Action:		Date:	

Emergency Contact Number:

Comment: 970-858-7546 / 911

Corrective Action:

Date: \_\_\_\_\_

Overall Good: ☒

<b>Spills:</b>			
Type	Area	Volume	

In Containment: No

Comment:

☐ Multiple Spills and Releases?

<b>Fencing/:</b>			
Type	WELLHEAD		
Comment:	Hog Paneling		
Corrective Action:		Date:	
Type	TANK BATTERY		
Comment:	Hog Paneling		
Corrective Action:		Date:	

<b>Equipment:</b>				corrective date
Type:	#			
Comment:	<p>Previous inspection observed that the wildlife protection BMPs (Netting) at the pit is in disrepair; holes/tears within netting observed. Inspection required Operator to Install or repair wildlife protection equipment.</p> <p>It was observed in this inspection that work to maintain wildlife protection BMPs has been performed. This corrective action has been addressed.</p>			
Corrective Action:				Date:
Type:	#			
Comment:	<p>Previous inspection observed that wildlife protection BMPs at the methanol tank have not been installed or maintained in such a manner that minimizes adverse impacts to wildlife resources, resulting in bird mortality within the secondary containment. Inspection required Operator to Install or repair wildlife protection equipment.</p> <p>It was observed in this inspection that the container and secondary containment BMP have been removed from the Location. Corrective action is no longer applicable.</p>			
Corrective Action:				Date:

**Tanks and Berms:**

Contents	#	Capacity	Type	Tank ID	SE GPS
PRODUCED WATER	1	<100 BBLS	STEEL AST		,
Comment:	See "Signs/Markers" for labeling requirements.				
Corrective Action:					Date:

**Paint**

Condition					
Other (Content)	95 bbl				
Other (Capacity)					
Other (Type)					

**Berms**

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Adequate	Walls Sufficient	Base Sufficient	Adequate
Comment:	Containment BMP appeared to be in proper functioning condition at time of inspection.			
Corrective Action:				Date:

**Venting:**

Yes/No			
Comment:			
Corrective Action:			Date:

**Flaring:**

Type			
Comment:			
Corrective Action:			Date:

**Inspected Facilities**Facility ID: 210444 Type: WELL API Number: 045-06200 Status: SI Insp. Status: RI**Idle Well**Purpose: ☒ Shut In ☐ Temporarily Abandoned Reminder: \_\_\_\_\_Comment: Records show well status of "Shut In" since June 2020. Form 5B 403291584 on file per Inactive Well requirements.

Operator submitted Form 4 #403053845 requesting approval of alternative MIT based on bradenhead testing. Sundry was approved with conditions requiring annual bradenhead tests reported on a Form 17.

Per Form 17 #403386717, annual bradenhead test performed 4/19/2023.

Corrective Action: \_\_\_\_\_ Date: \_\_\_\_\_

Facility ID: 322414 Type: LOCATION API Number: - Status: AC Insp. Status: RI

**Reclamation - Storm Water - Pit****Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment

Comment: [See "COGCC Comments"](#)

Corrective Action:

Date: \_\_\_\_\_

**Pits:** ☐ NO SURFACE INDICATION OF PIT**COGCC Comments**

Comment	User	Date
<b>STOMWATER</b>  Inspection #696204815 observed that the Location was out of compliance with Rule 1002.f.(2) requirements; spill prevention and containment BMPs inadequate; runoff resulting in degradation at the access road and the Salt Creek Drainage. Inspection required Operator to comply with Rule 1002.f.(2).  It was observed in this inspection that corrective actions have been taken by the Operator; erosion degradation at road has been repaired, though it is unclear if BMPs to stabilize the soil are adequate; soils appear to be at risk to wind erosion/fugitive dust. Additional controls (ditch, culvert) have been implemented along road to manage runoff.  Continue to monitor and maintain BMPs; ensure controls remain in proper functioning condition to minimize erosion, degradation, off-site sediment transport and fugitive dust.	trujilloam	05/09/2023

**Attached Documents**You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
403398460	INSPECTION SUBMITTED	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6109154">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6109154</a>
696204910	Inspection Photos	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6109136">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6109136</a>