

Inspection Photos

5/15/2023

Operator: OXY USA INC - 66561

Location Number: 312529

Mesa County, CO

Aaron Trujillo
NW Reclamation Specialist
COGCC

Inspection Photos

Operator Name: OXY USA INC - 66561

Location Number: 312529



Photo 1: Photos 1-2 taken from the south end of the Location. Photos provide an overview of the Location from west, northwest, northeast to east.

Inspection Photos

Operator Name: OXY USA INC - 66561

Location Number: 312529



Photo 2: See comments under photo 1.

Inspection Photos

Operator Name: OXY USA INC - 66561

Location Number: 312529



Photo 3: Photo example showing Fence along the perimeter of the Location has not been maintained. Fence requires maintenance or removal.



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Inspection Photos

Operator Name: OXY USA INC - 66561

Location Number: 312529



Photo 4: Photos 4-6 examples showing the access road has not been reclaimed in accordance with 1004 requirements.

Inspection Photos
Operator Name: OXY USA INC - 66561
Location Number: 312529



Photo 5: See comments under photo 4.

Inspection Photos

Operator Name: OXY USA INC - 66561

Location Number: 312529



Photo 6: See comments under photo 4. Photo also shows stormwater and erosion control BMPs are insufficient to manage runoff; runoff from access road resulting in sediment deposition within a drainage and wetland area

Inspection Photos

Operator Name: OXY USA INC - 66561

Location Number: 312529



Photo 7: Sediment discharge and deposition from the access road.

Inspection Photos

Operator Name: OXY USA INC - 66561

Location Number: 312529



Photo 8: Sediment discharge and deposition from the access road.

Inspection Photos
Operator Name: OXY USA INC - 66561
Location Number: 312529



Photo 9: Photo shows access road has not been reclaimed; drainage has not been recontoured/regraded to its original relative grade. Culvert remaining.

Inspection Photos
Operator Name: OXY USA INC - 66561
Location Number: 312529



Photo 10: Photo showing the access road has not been reclaimed in accordance with 1004 requirements.