

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

05/15/2023

Submitted Date:

05/17/2023

Document Number:

690204228

FIELD INSPECTION FORMLoc ID 324900 Inspector Name: COSTA, RYAN On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**

OGCC Operator Number: 16520

Name of Operator: CHEMCO INC

Address: 6970 SOUTH HOLLY CIR STE 206

City: CENTENNIAL State: CO Zip: 80112

Status Summary:☐ THIS IS A FOLLOW UP INSPECTION☒ FOLLOW UP INSPECTION REQUIRED☐ NO FOLLOW UP INSPECTION REQUIRED**Findings:**

6 Number of Comments

5 Number of Corrective Actions

☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Neher, Morgan		morgan@chemco-og.com	
Neher, Gray		gh.neher@chemco-og.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
261201	WELL	PR	06/01/2020	OW	061-06782	BAUGHMAN 5A-2	RI

General Comment:

On 5/15/2023, Ryan Costa conducted a location and stormwater management inspection.
See attached photos and additional details within this report.

Location

Lease Road:			
Type	Access		
comment:	Vehicles are driving outside of the designated road boundary causing unnecessary disturbance.		
Corrective Action:	Immediately Comply with 1002.e. to restrict access to original access road boundry.	Date:	05/17/2023

Overall Good: ☐

Signs/Marker:			
Type	BATTERY		
Comment:			
Corrective Action:		Date:	

Emergency Contact Number:

Comment:

Corrective Action: Date:

Good Housekeeping:

Type	OTHER		
Comment:	There are oil stained soils at the base of the pumpjack that need to be cleaned up.		
Corrective Action:	Immediate clean up of stained soil. Implement or modify BMPs for improved material handling and spill prevention.	Date:	05/31/2023

Overall Good: ☐

Spills:				
Type	Area	Volume		
Crude Oil	Tank			
Comment:	There is a leak at the pipe outlets at the front and backside of the tanks. Stained soils need to be cleaned up and leak needs to be repaired.			
Corrective Action:	Control and contain spills/releases and clean up per Rule 912.a.			Date: 05/19/2023

In Containment: No

Comment: ☐ Multiple Spills and Releases?**Tanks and Berms:**

Contents	#	Capacity	Type	Tank ID	SE GPS	
CRUDE OIL	2	300 BBLS	FIBERGLASS AST		,	
Comment:						
Corrective Action:						Date:

Paint

Condition	<input type="text"/>	
Other (Content)	<input type="text"/>	
Other (Capacity)	<input type="text"/>	
Other (Type)	<input type="text"/>	

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance	
Earth	Inadequate	Walls Insufficient	Base Insufficient	Inadequate	
Comment:	The secondary containment berm is insufficient to contain a spill and needs to be rebuilt.				
Corrective Action:	Repair or install berms or other secondary containment devices per Rule 912.d.(1).			Date:	07/07/2023

Venting:

Yes/No			
Comment:			
Corrective Action:		Date:	

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Reclamation - Storm Water - Pit**Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment

Comment: There are vehicle ruts from vehicle driving outside of the access road boundry. Areas of rutting need to be repaired and stabilized.

Corrective Action: Install or repair required BMPs per Rule 1002.f.(2)

Date: 05/31/2023

Pits: ☐ NO SURFACE INDICATION OF PIT

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
690204229	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6117556