

Interim Reclamation and Stormwater Inspection

Date: 05/26/2023

Operator: FUNDARE RESOURCES OPERATING
COMPANY LLC - 10773

Location ID: 430313

Inspection Document #: 708200284

Weld County, CO

NWSW Section 27 T10N R58W

Dylan Edwardson
Reclamation Specialist, COGCC



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Photos
Location Name: Razor 27L Pad
Location ID: 430313



Photo 1. Tumbleweed accumulation around flare will need to be removed as they present a fire hazard.

Inspection Photos
Location Name: Razor 27L Pad
Location ID: 430313



Photo 2. Examples of debris/trash observed on location. The Operator shall self inspect the entire location to identify and remove any trash/debris.

Inspection Photos
Location Name: Razor 27L Pad
Location ID: 430313



Photo 3. Buried suck rod observed on the east end of the location, highlighted by red outline. All debris/trash/unused equipment will need to be removed from location.

Inspection Photos
Location Name: Razor 27L Pad
Location ID: 430313



Photo 4. See comments in Photo 2.

Inspection Photos
Location Name: Razor 27L Pad
Location ID: 430313



Photo 5. Loose/unstrung barb wire observed on the northern end of the location will need to be repaired and/or removed as it poses a hazard to personnel and wildlife.

Inspection Photos
Location Name: Razor 27L Pad
Location ID: 430313



Photo 6. Open top drum observed next to pumpjack had free fluids (apparent hydrocarbons) and was not placed in secondary containment or had a lip/top. This will either need to be removed and properly disposed of, or placed in secondary containment with a lid to prevent/exclude wildlife entry.

Inspection Photos
Location Name: Razor 27L Pad
Location ID: 430313



Photo 7. Stained soil will need to be properly cleaned and disposed of per Rule 905.e.

Inspection Photos
Location Name: Razor 27L Pad
Location ID: 430313



Photo 8. Western portion of location. Evidence of sediment transport onto the location from unstabilized bank/soils. Additional repair or implementation of stormwater BMPs is required to prevent further erosion from occurring.

Inspection Photos
Location Name: Razor 27L Pad
Location ID: 430313



Photo 9. Northern interim reclamation area. The interim areas are not progressing towards Rule 1003 standards with evidence of non-uniform vegetation cover resulting in bare soil and areas of undesirable vegetation (e.g. kochia). Additional reclamation activities are required.



Photo 10. Close up photo of undesirable vegetation (e.g. kochia).

Inspection Photos
Location Name: Razor 27L Pad
Location ID: 430313



Photo 11. Eastern interim area; see comments in Photo 9.

Inspection Photos
Location Name: Razor 27L Pad
Location ID: 430313



Photo 12. Southeastern interim area; see comments in Photo 9.